
General Service Bulletin (GSB):	All - Wheel Drive PTU Sealing			
GSB Overview:	This bulletin is intended to assist with the diagnosis and repair of Al wheel Drive Power Transfer Unit (PTU)-related fluid leaks.			
NOTE: This information is not intended to replace or supersede any warranty, parts and service policy, Work Shop Manual (WSM) procedures or technical training or wiring diagram information.				

### Contents:

2007-Current Vehicles with a 6F50/55 Transmission	
and 2008-2012 Vehicles with an Aisin AW21 Transmission	_Page 2
2009-2012 Escape with a 6F35 Transmission	_Page 4
2010-2012 Fusion with a 6F35 Transmission	_ Page 6
2013-Current Vehicles with 6F35 Transmission	Page 8


2007-Current Vehicles with 6F50/55 Transmission

2008 – 2012 Vehicles with Aisin AW21 Transmission

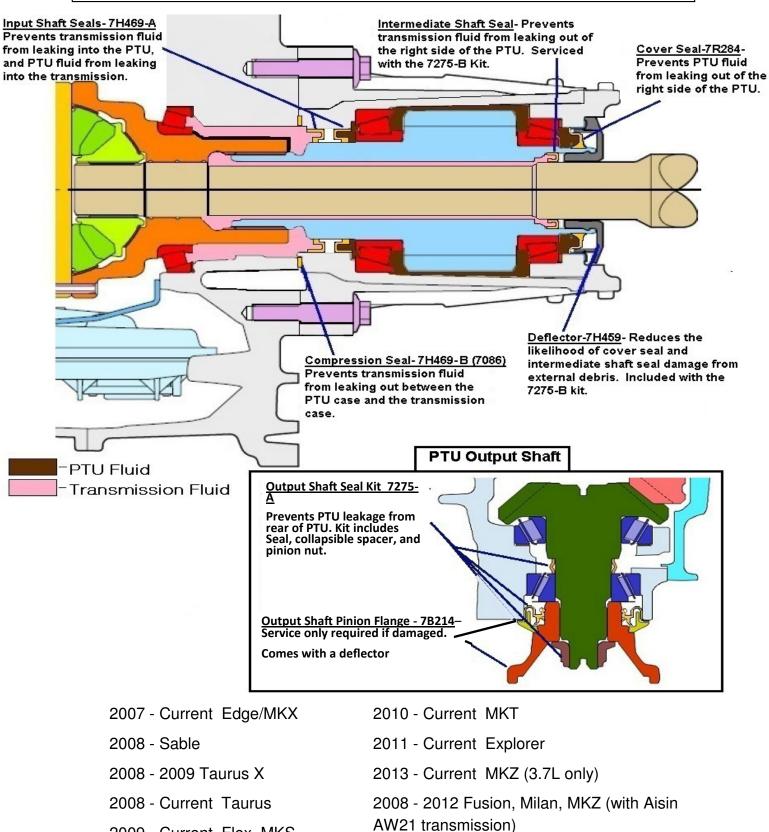

2009 - Current Flex, MKS

2007 – Current Vehicles with 6F50/55 Transmission 2008 – 2012 Vehicles with Aisin AW21 Transmission

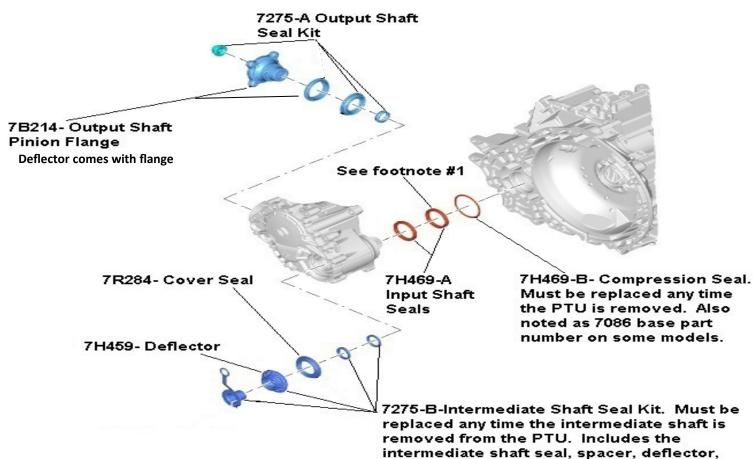


and	the	seal	protector.
			PI V

Seal Name	Base Part Number	Fluid Leak	Location of Leak	PTU Removal Required for Replacement	Other PTU Seals Re- quired for Re - placement	Labor Operation
Intermediate Shaft Seal	7275B kit		Right side of the PTU	No	None	7275B
Cover Seal	7R284 (3)		Right side of the PTU	No	7275B Kit	7275C
Deflector	7H459		None	No	7275B Kit	7275B
Input Shaft Seal	7H469		Transmission fluid leaks into PTU $^{\scriptscriptstyle (2)}$	Yes	7086, 7275B Kit	7003B+ 7003B6
Output Shaft Seal	7275A kit		Rear of PTU	No	None	7275A
Compression Seal	7086/7H469B		Between PTU and Transmission	Yes	7275B Kit	7003B


(1) This seal omitted from vehicles with Aisin AW21 transmission.

(2) Typically results in fluid coming out of PTU vent.

(3) See Catalog. Part of 7275B kit on some vehicles.

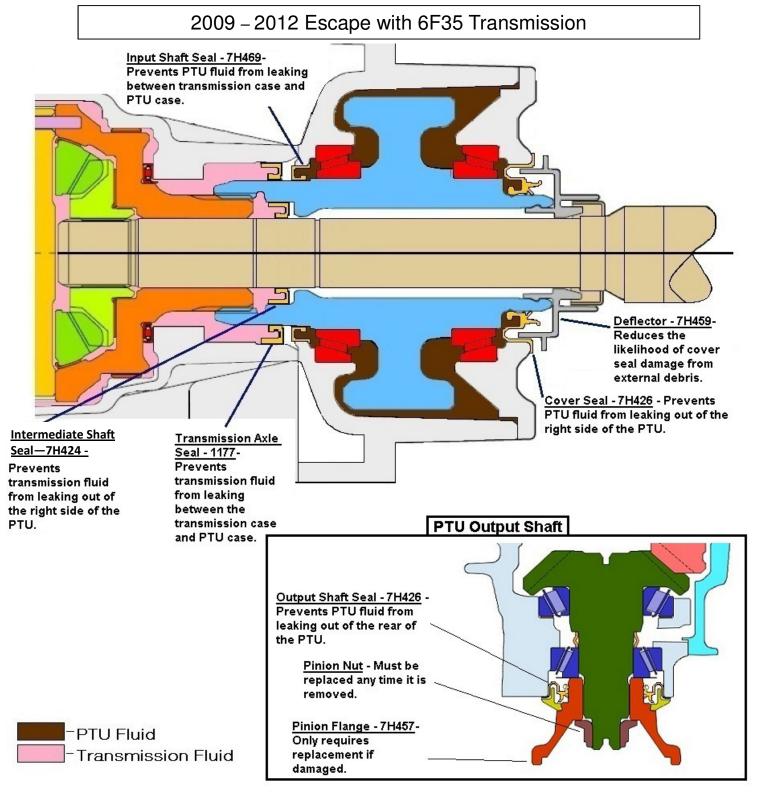

2009 - 2012 Escape 2.5L, 3.0L

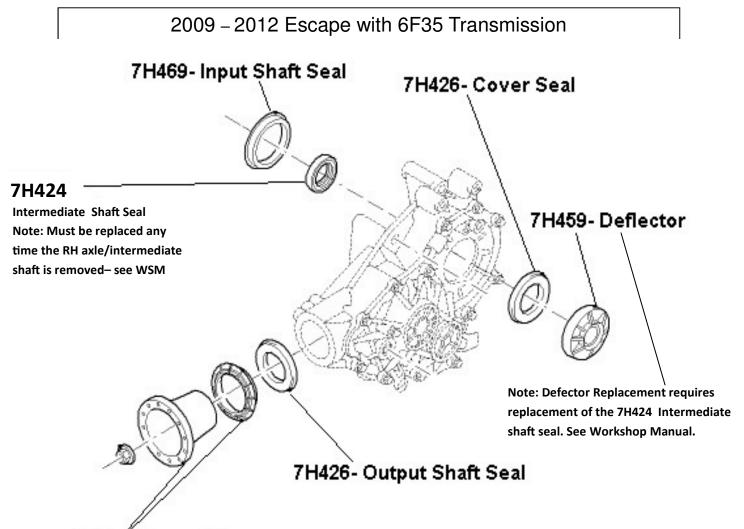


7B214 - Pinion Flange Kit

Seal Name	Base Part Number	Fluid Leak	Location of Leak	PTU Removal Required for Replacement	Other PTU Seals Required for Replacement	Labor Operation
Intermediate Shaft Seal	7H424		Right side of PTU	Yes	None	7003B+ 7003B3
Cover Seal	7H426		Right side of PTU	Yes	7H459+7H424	7003B+ 7003B4
Deflector	7H459		None	No	7H424	7003B + 7003B4
Input Shaft Seal	7H469		Between PTU and Transmission <sup>(1)</sup>	Yes	7H424	7003B+ 7003B6
Output Shaft Seal	7H426		Rear of PTU	No	None	7275A
Transmission Axle Seal	1177		Between PTU and Transmission	Yes	7H424	7003B


1 - PTU disassembly required to replace the input shaft seal. Refer to WSM, Section 308-07.

### 2010-2012 Fusion with a 6F35 Transmission

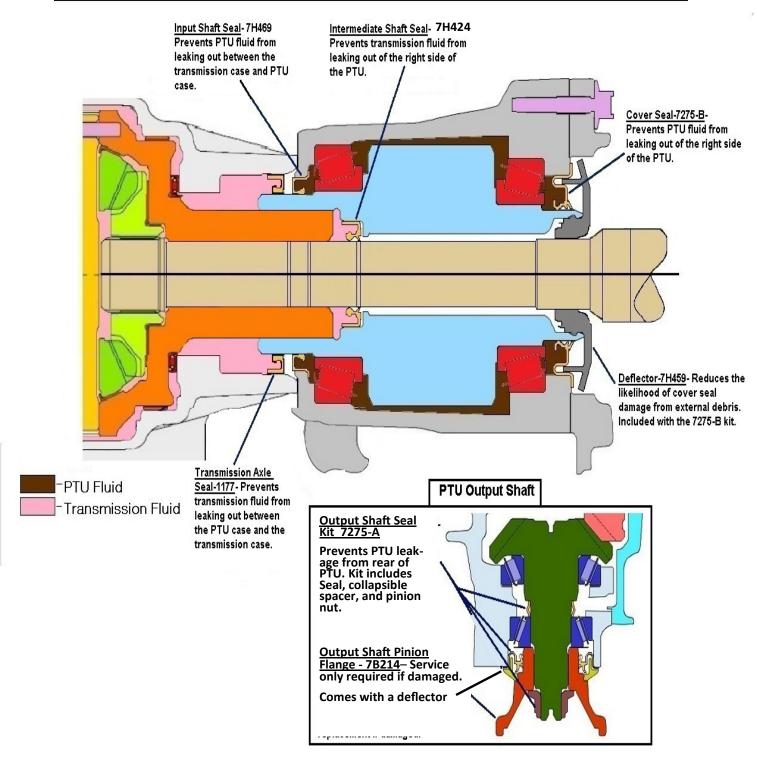

#### 2010 - 2012 Fusion 2.5L, 3.0L


## 2010-2012 Fusion with a 6F35 Transmission

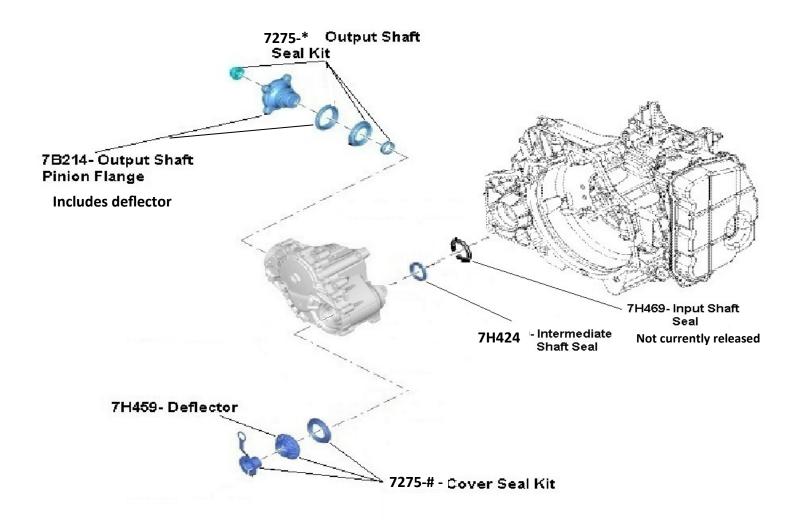

Seal Name	Base Part Number	Fluid Leak	Location of Leak	PTU Removal Required for Replacement	Other PTU Seals Required for Replacement	Labor Operation
Intermediate Shaft Seal	7H424		Right side of PTU	Yes	None	7003B
Cover Seal	7275-# kit		Right side of PTU	Yes	7H424	7003B +7275C
Deflector	7H459		None	Yes	7H424	7003B +7275C
Input Shaft Seal	7H469		Between PTU and Transmission <sup>(1)</sup>	Yes	7H424 + 7275-# kit	7003B
Output Shaft Seal	7275-* kit		Rear of PTU	No	None	7275A
Transmission Axle Seal	1177		Between PTU and Transmission	Yes	7H424	7003B


(1) - PTU disassembly required to replace the input shaft seal. Refer to WSM, Section 308-07.

## 2013 - Current Vehicles with 6F35 Transmission

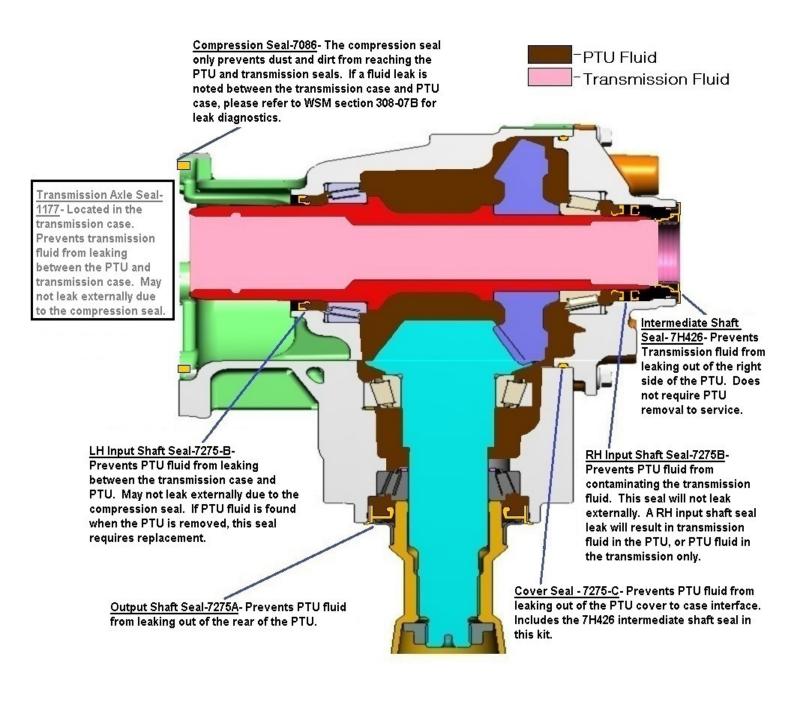

- 2013 Current Escape 1.6L GTDI, 2.0L GTDI
- 2013 Current Fusion 1.6L GTDI, 2.0L GTDI
- 2013 Current MKZ 2.0L GTDI (not used on 3.7L MKZ)
- 2015 Current MKC 2.0L GTDI, 2.3L GTDI
- 2015 Current Edge 2.0L GTDI

### 2013 - Current Vehicles with 6F35 Transmission

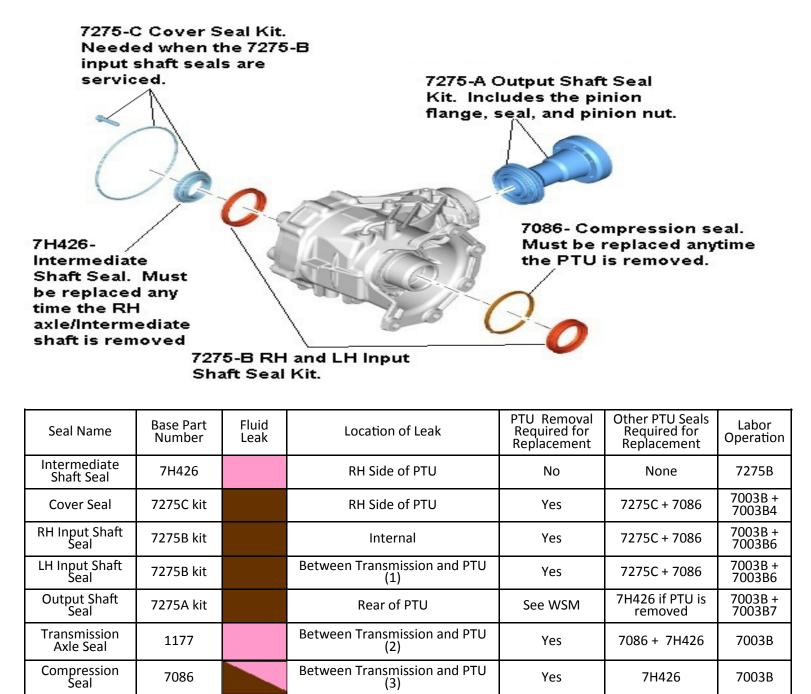

(1) The LH input shaft seal may not result in an external leak. If PTU fluid is found after PTU removal, replace the LH input shaft seal.

(2) The transmission axle seal may not result in an external leak. If transmission fluid is found after PTU removal, replace the transmission axle seal.

(3) The compression seal only prevents dirt and debris from reaching the PTU and transmission seals. However, it may temporarily seal a leak in this location. If a leak is noted between the transmission and PTU, refer to WSM, Section 308-07.