TESLA	Tesla, In Service Bull		Replace Pyrotechnic HV Battery Disconnec				
SB-25-16-003							
June 3, 2025							
Classification		Section/Group	Mobile Service	Configuration			
Campaign Bulletin		16 - HV Battery	Cannot Perform	All			
Model	Model Yea	ar Country/Region	Build Location	Build Location			
Model S	2012–2020	All	Fremont				
Model X	2015–2020						
The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.							

Campaign Bulletin: This campaign bulletin addresses a non-safety-related condition and provides recommended technical diagnosis and repair procedures. Apply this procedure to the applicable vehicles.

Condition

On certain Model S and Model X vehicles, the battery powered Pyrotechnic High Voltage (HV) Battery Disconnect will reach the end of its battery lifespan in the near future, which will trigger alerts and may limit the vehicle's performance.

Correction

Replace the battery powered Pyrotechnic HV Battery Disconnect with a self-powered Pyrotechnic HV Battery Disconnect.



NOTE: If this bulletin is applicable to the vehicle, perform the correction without any need for inspection.

Correction Description	Correction	Time	
		Model S	Model X
Replace Pyrotechnic HV Battery Disconnect - HV Battery 1.0 And 1.5	S012516003	2.10	N.A.
Replace Pyrotechnic HV Battery Disconnect - HV Battery 2.0	S022516003	0.54	0.66

	Part Number	Description	Quantity	
Parts Required	1111313-00-F 1111445-00-F	One of the following, based on the VIN: DISCONNECT, PYROTECHNIC, CUR POWERED, 2000A DISCONNECT, PYROTECHNIC, CUR POWERED, 2366A	1 1	
	•	ere current at the time of publication. Use the revisions listed or later, ified in the Parts Catalog.		
Special Tools	1059330-00-A 1057606-00-A 1076927-00-A	SOCKET,DR 5LOBE,E-TORX MAG,0.25INCH 1/4" DRIVE 13MM SOCKET - CEMENTEX HIOKI MODEL 3548 RESISTANCE METER		
	1055662-00-A	One of the following, based on the region: ANTI-STATIC MAT/W WRIST GROUNDING CORD AND WRI - NORTH AMERICA	ST STRAP	
	1056154-01-B	ANTI-STATIC MAT/W WRIST GROUNDING CORD AND WRI - EU SCHUKO	ST STRAP	
	1056154-02-B	ANTI-STATIC MAT/W WRIST GROUNDING CORD AND WRI - UK, IRELAND	ST STRAP	
	1056154-03-B	ANTI-STATIC MAT/W WRIST GROUNDING CORD AND WRI - SWITZERLAND	ST STRAP	
	1056154-04-B	ANTI-STATIC MAT/W WRIST GROUNDING CORD AND WRI - DENMARK	ST STRAP	
	1006653-00-A 1076921-00-A	For HV Battery 1.0/1.5 only: FLAG,REMOVED FUSE,HVBAT,MDLS FLUKE 1587 MULTI-METER		

Procedure

Replace the Pyrotechnic HV Battery Disconnect. Refer to one of the following:

- HV Battery 1.0/1.5: Service Manual procedure 16308702; Model S.
- HV Battery 2.0: Service Manual procedure 1638502; Model S, Model X.