

	GROUP	MODEL
	BOD	2026MY EV9 (MV1a)
	NUMBER	DATE
	354	May 2026
TECHNICAL SERVICE BULLETIN		
SUBJECT: SERVICE ACTION: FRONT SEAT SLIDE MOTOR NOISE (SA647)		

This bulletin provides information to remove the seat slide motor tube from the power front seats on certain 2026MY EV9 (MV1a) vehicles produced from January 2, 2025, through January 3, 2026, that are in dealer stock only. The subject vehicles may exhibit a buzzing noise while the user operates the power seat slide (forward and rearward) functions. This condition does not affect seat functionality. Follow the procedure outlined in this publication to remove the seat slide motor tube from the front seats of the applicable vehicle. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs in **dealer stock only**.



 NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on KDealer+ (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on KDealer+ (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

This issue number is SA647.


Inspection Procedure:

1. Open the rear seat bolt caps (A) of the driver seat.
2. Loosen the two (2) rear seat bolts (B).




Tightening torque for bolts (B):
32.5 - 43.4 lb.ft (44.1 - 58.8 N.m)


3. Place a piece of wood under each seat rail (C) to lift the rear end of the driver seat.

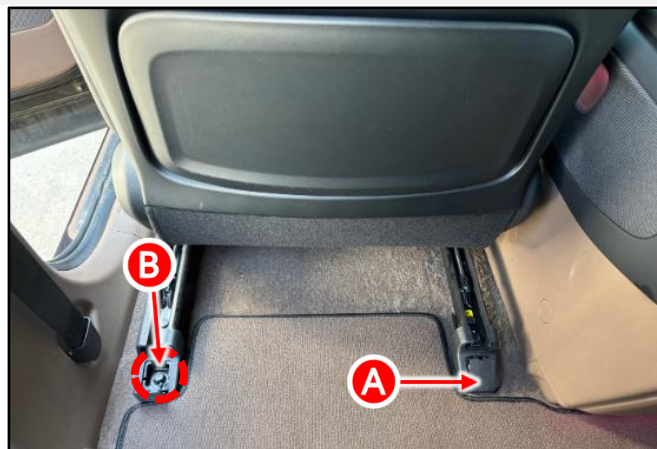

4. Loosen the two (2) screws (D) to remove the sliding motor.

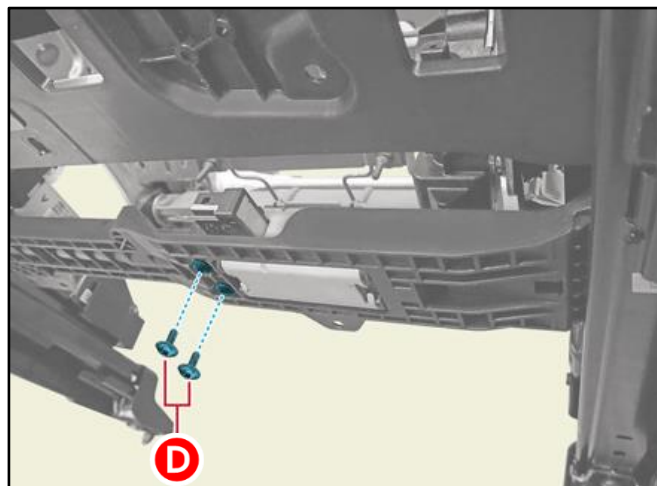

- 5a. Lift the sliding motor cable (E).

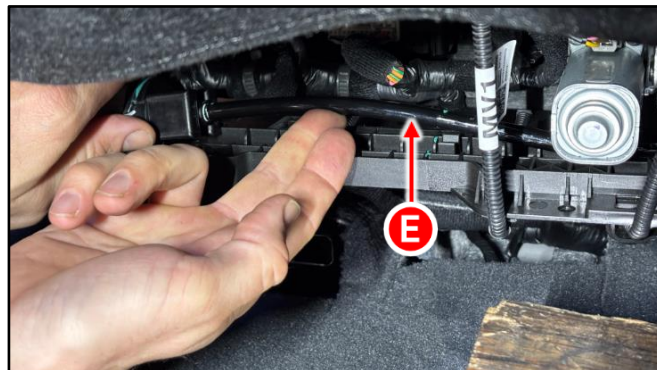


SUBJECT:

SERVICE ACTION: FRONT SEAT SLIDE MOTOR NOISE (SA647)

5b. Disconnect the sliding motor connector (F).




5c. Remove the sliding motor (G).

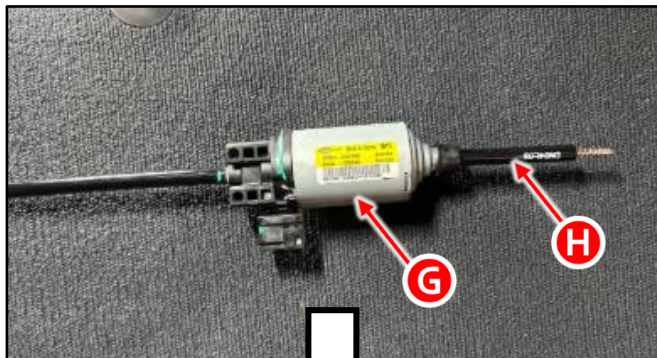

6a. Remove the sliding motor tube (H) off the sliding motor (G) and discard.



6b. If the sliding motor tube (H) does not come out with the sliding motor, use needle-nose pliers to remove the sliding motor tube (H).

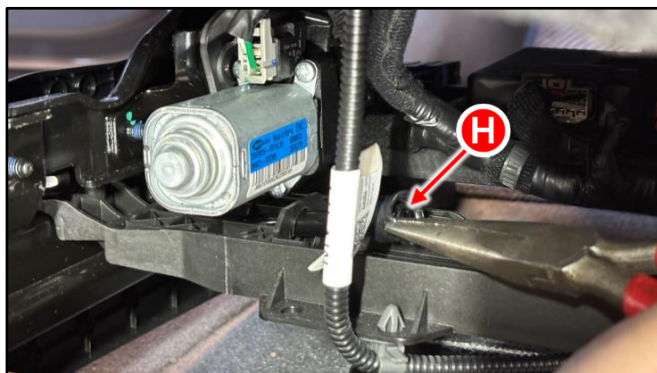

7. Reinstall all removed parts in reverse order of removal.

8. Repeat steps 1 - 7 for the passenger front seat sliding motor.

9. Confirm normal operation.



SUBJECT: SERVICE ACTION: FRONT SEAT SLIDE MOTOR NOISE (SA647)

AFFECTED VEHICLE RANGE:

Model	Production Date Range
EV9 (MV1a)	January 02, 2025 to January 03, 2026

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	886A1 L1000	0	(SA647) Front Seat Motor Tube Removal	260A17R0	0.8 M/H	N/A	0

Note: When substitute transportation is provided, manually enter sublet code 'X2' for rental expense reimbursement or one roundtrip rideshare expense.

 NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA647 when accessing the KDealer+ system.