

L634-
A.02.26

To: After Sales Official Network
Subject: Sound symposer covered
Date: 25/05/2026
Pages: 4



Campaign code:
L634-A.02.26

Campaign name:
Sound symposer covered

Model:
Temerario

Model Year:
2026

Markets:
Azerbaijan, Canada, Czech Republic, France, Germany, Hungary, Indonesia, Italy, Japan, Lebanon, Malaysia, Netherlands, Norway, Poland, Portugal, Romania, Spain, Switzerland, Turkey, United Arab Emirates, United Kingdom, United States

VIN Involved:
From TLA139 to TLA0451

Important information: before proceeding with the repair, connect to the Warranty Portal and, using the "VIN Info" function, check that:

- the vehicle is actually affected by the instructions contained in this bulletin.

NOTE: some vehicles may not be affected, despite the fact that their Vehicle Identification Number (VIN) falls within the range;

- only replacement parts that correspond to the specific operation, identified by a letter (such as A, B, C, etc.), are to be used for the chassis being repaired.

Example

Code	Type	Description	Bulletin	Proc.
LXX-A.XX.XX		CAMPAIGN NAME		B



NOTE:

Operation A will be available only when the instructions require a preliminary check to be performed to determine whether or not the vehicle actually needs updating.

Information for the service network:

During ongoing product monitoring, Automobili Lamborghini S.p.A. requires reworking of the sound symposer with the introduction of a closing plate and replacement of a bushing.

Solution for the field:

Reworking of the sound symposer

Spare Parts:

OPERATION B

Kit	Description	Q.ty
4LA198542	Kit for sound symposer	1

The KIT contains

Part number	Description	Q.ty
07N129545	Symposer closure plate	2
07N129227	Bushing	2

Rev.00

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A pursuant to copyright law. The company reserves the right to make updates and modifications as needed. The reprinting, reproduction, distribution to unauthorized persons and/or to third parties, and the partial or complete translation of the material contained herein are prohibited without the express written consent of Automobili Lamborghini S.p.A.

Doc. no.: L/V6_M06 Rev.[07]

1/4



Management of replaced parts:

Store the components that have been removed from the vehicle in an appropriate manner, marking them with their corresponding bar codes so that they can be identified during visits by the competent Area Manager.

Labor time:

Operation B: 7 h

Previous bulletins superseded.

None.

Warranty claim instructions:

To request reimbursement for the repair performed, access the "LIASS" system on the Lamborghini portal and, following the instructions in the system's "Manuals" section, generate and fill out a Warranty Request. Select the required campaign and proceed with entry; carefully read the options present in the alert message that displayed by the system (see example) and select the option performed on the vehicle.

Reimbursement will be structured as follows, on the basis of the operation performed:

- **OPERATION B:**
 - o Steps to be executed: from 1 to 9
 - o Labour time: 7 h

Important information:

attach all documents generated during the work carried out, evidence of the work itself, for instance work orders and diagnostic protocols with BETA-Reports.

If one or more of these is missing, it may lead to a rejected reimbursement request.

Fill out the page in the warranty booklet (identified in the image below) in the section "Service and Recall Campaigns":

Tools/Materials required

Code	Description.	Q.ty
------	--------------	------



NOTE:

All O.D.I.S. Service technical documentation can be viewed on the app "O.D.I.S. Self Service Guide" available on Lamborghini HUB portal.

Repair method:**OPERATION B: rework Sound Symposer.**

Follow the instructions given in the Workshop Manual at the following path:

1. Sound Symposer assembly (Right) - Removal procedure


Engine > Sound Symposer > Sound Symposer assembly (Right) - Replacement procedure > *Sound Symposer assembly (Right) - Removal procedure*

2. Sound Symposer assembly (Left) - Removal procedure

Engine > Sound Symposer > Sound Symposer assembly (Left) - Replacement procedure > *Sound Symposer assembly (Left) - Removal procedure*

After that, follow the instructions below:

3. With the Sound Symposer group on bench, unscrew the two TP6X45 screws (1), remove the Sound Symposer connector (2) and position the closing plate (3) between the connector (2) and the valve (4).

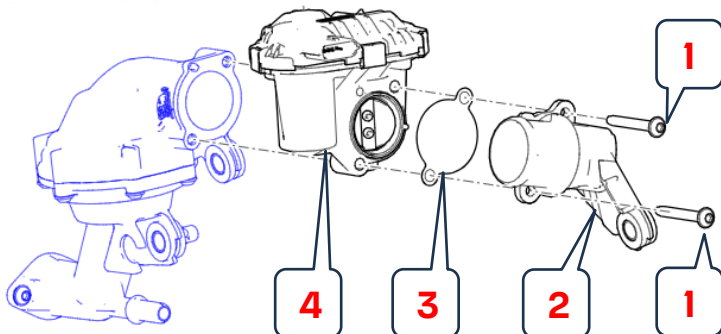


4. Secure the Sound Symposer connector (2) using the two TP6X45 screws (1).


Pre-tightening torque: 4.0 Nm (2.95 lbf ft)

Tightening torque: 7.0 Nm (5.16 lbf ft)

5. During installation, be sure to check that the valve connections (4) are facing in the correct direction.

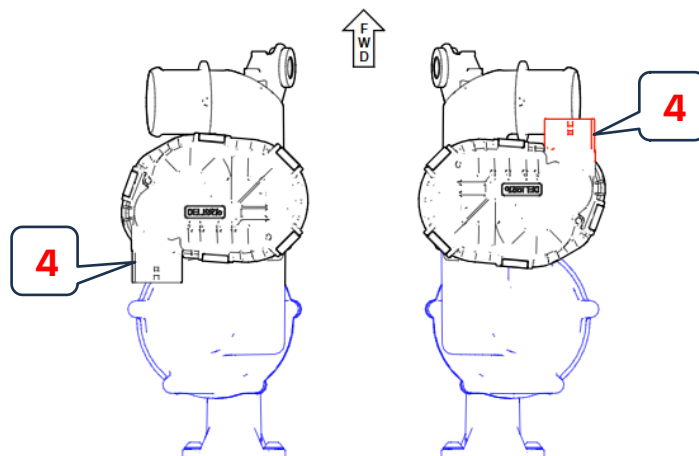



6. Before reinstalling the Sound Symposer in the vehicle, replace the bushings (5) with the new ones (code 07N129227) on the fixing connector (2).

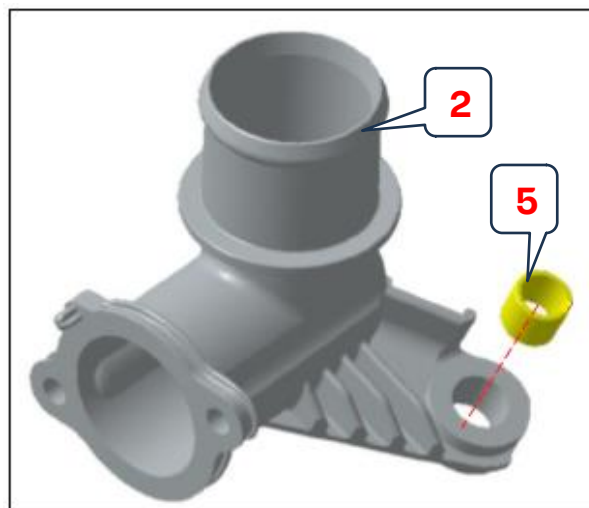



7. To replace the bushing (5), unscrew the M6x25 screw (6) and remove the seal together with the bushing and its washers. Then replace the bushing (5). Refit the seal with the new bushing and its washers, and secure them with the M6x25 screw (6).

Tightening torque: 8.00 Nm (5.90 lbf ft) $\pm$ 10%

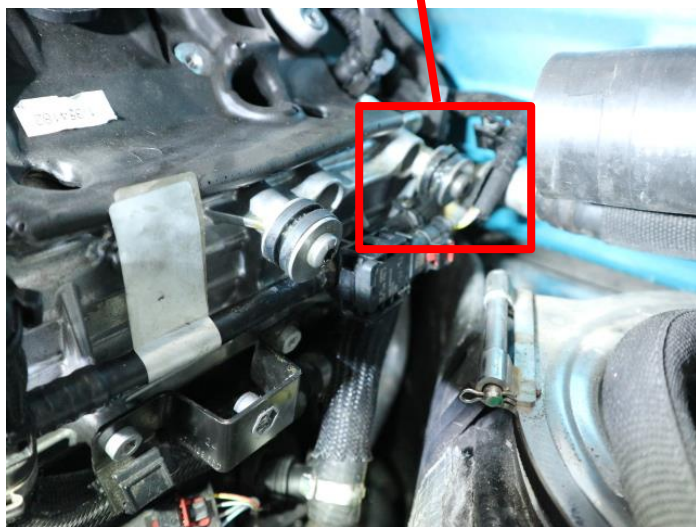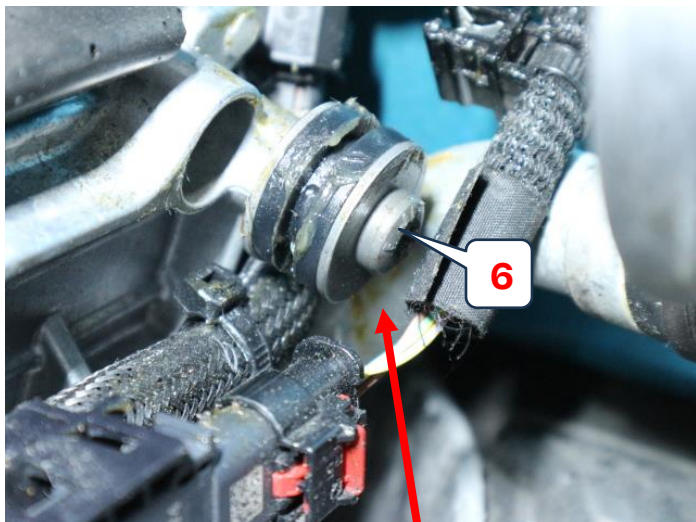

After that, follow the instructions given in the Workshop Manual at the following path:

8. Sound Symposer assembly (Right) - Installation procedure

Engine > Sound Symposer > Sound Symposer assembly (Right) - Replacement procedure > *Sound Symposer assembly (Right) - Installation procedure*

9. Sound Symposer assembly (Left) - Installation procedure

Engine > Sound Symposer > Sound Symposer assembly (Left) - Replacement procedure > *Sound Symposer assembly (Left) - Installation procedure*



IMPORTANT:

The documents which must be provided together with the operation under warranty request are:

- *Produced Repair Order*
- *Saved Diagnostic Protocol with BETA report*

Failure to follow these procedures could lead to the request being rejected.

For more information, please contact your Area Manager or open a ticket to Technical Support in Lamborghini KEY (Request – General Information – After Sales Services - After Sales Technical Support).

Regards,
Lamborghini Service