



STAR ONLINE PUBLICATION



Case Number: S2608000025

Release Date: May 2026

Symptom/Vehicle Issue: B22AE-96 Setting Erroneously In Trailer Reverse Steering Knob Module (TRSKM)

Models Affected:

2025-2026 Ram 3500 Pickup (D2)	2025-2026 Ram 2500 (DJ)
--------------------------------	-------------------------

Discussion: Upon scanning the vehicle for DTC's you may find B22AE-96 - Trailer Reverse Steering Knob Module Internal Performance - Component Internal Failure setting in the TRSKM.

B22AE-96 indicates a failure of the LED backlighting of the TRSKM and may be setting erroneously due to an internal software issue.

Diagnosis: Enable the instrument panel backlighting and observe the Trailer Reverse Steering LED backlighting. If the backlighting operates normally and there are no associated customer complaints, this DTC can be ignored.

If there is a related customer concern or the LED backlighting is inoperative. Perform the B22AE-96 DTC diagnostics.

Do not automatically replace the TRSKM for this DTC.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.