

ESB E062: PACCAR MX Doser Fuel Line Clamp Campaign

 [Edit](#)  [Clone](#)

Number

E062

Subject

PACCAR MX Doser Fuel Line Clamp Campaign

Date

1/3/2013

Revision

05/27/2026: Updated PRWS Claim coding.

07/09/2013: Bracket and flange bolt part numbers added to parts section.

05/16/2013: Bracket and flange bolt part numbers temporarily removed due to availability.

04/04/2013: Revision to Parts section to include bracket and flange bolt part numbers.

Condition

A fuel line routing clamp was omitted on chassis listed. Campaign E062 identifies those chassis and the corrective action required.

Chassis Affected

90 T800s and W900s built between 02/02/12 – 07/31/12 and equipped with PACCAR MX engines. See the attached dealer-customer-chassis list.

Action

Service all chassis affected that enter your dealership, even if the customer has no issue with the chassis. Use the procedure below. Review DWC or SIR online systems to verify that campaign "E062" is still open or already completed prior to performing this repair.

Warranty

There is no time or mileage limit to this campaign. Kenworth will pay for parts at dealer net plus

applicable mark-up and 0.4 hours labor. Use Quick Claim E062

CLAIM CODING

PRWS CLAIM CODING			
Campaign Code:	E062	Campaign Type	Field Repair
Claim Category:	Engine	Repair Type	Proactive
Customer Concern Code	146	Causal Code	29
Corrective Action Code	14	Responsibility Code:	CAMP
Failure Location	044-001-024	Causal Part	1644961PE
Supplier Code	N/A	SRT Code	B13-04A 0.4 hrs Bulletin E062: PACCAR MX Doser Fuel Line Clamp Campaign

(KW) For campaign filing questions, reference Kenworth bulletin CB077.[]

Parts

Parts are available from PACCAR Parts.

Quantity	Part Number	Description
----------	-------------	-------------

1	1644961PE	Clamp – Pipe
1	1313138PE	Flanged Bolt, M8x16

Inspect the engine for the bracket used to secure the clamp (p/n: 1644961PE). Order the parts below ONLY if chassis is not equipped with a bracket.

Quantity	Part Number	Description
1	1851496PE	Bracket
1	1243078PE	Flanged Bolt

Procedure

Install the pipe clamp at the air compressor hose as illustrated on the attached.

File warranty Quick Claim E062 for reimbursement and as a record of correction.

 [E062 Campaign Procedure](#)

Links

 [E062 Dealer-Chassis List](#)

 [E062 Customer Letter](#)