

Subject:

GAS NOZZLE CLICKS OFF BEFORE FUEL TANK IS FULL/GURGLING IN THE FILLER NECK/EXCESSIVE FUMES OR MIST FROM THE FILLER NECK [PHEV]

Service Alert No.: SA-035/26

Last Issued : 05/19/2026

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS

2024-2026 CX-90 PHEV only

2025-2026 CX-70 PHEV only

DESCRIPTION


When refueling, you may occasionally notice:

- A gurgling sound from the fuel filler neck.
- The gas dispenser nozzle clicks off before the tank is full.
- Fuel vapor or mist from the filler neck.

This can occur if 20 minutes have elapsed after pressing the fuel lid button and the fuel tank has resealed the Vapor Recovery System (VRS) before refueling is complete.

Before Refueling

1. Press the fuel-filler lid opener switch.

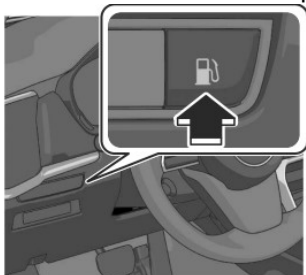

- The system will release pressure in the tank through the vapor recovery system (charcoal canister) and enter Refueling Mode.
- You'll see "Ready to Refuel" displayed on the instrument cluster.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

2. You now have 20 minutes to complete refueling. **After 20 minutes, or if the vehicle is turned to "READY ON," the tank will automatically reseal the vapor recovery system.**

- If the tank vapor recovery system has resealed, you may notice:
 - The gas pump dispenser clicks off before the tank is full.
 - A gurgling sound from the filler neck.
 - Fuel vapor or liquid may spit back from the filler neck.
- If this happens:
 1. Press the fuel-filler lid switch again.
 2. Wait until the instrument cluster displays "Ready to Refuel."
 3. Continue refueling.

Refer to the owner's manual pages 5-106 and 5-107 for refueling details.

PARTS INFORMATION

No parts for this concern.

WARRANTY INFORMATION

Normal warranty applies

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.