




Service Information

Offboard Diagnostic Information System Service (ODIS Service) Number: AOS-26-25

Subject: Audi Brand 2.41.1 Update Causing ODS5003E Errors on the 90TV SVM Flash Hotfix Instructions Date: May 26, 2026

Hotfix Alert!

Issue seen: The ODIS Audi Brand update 2.41.1 is setting a ODS5003E error code when you perform the 90TV SVM flash. This hotfix will correct this concern.

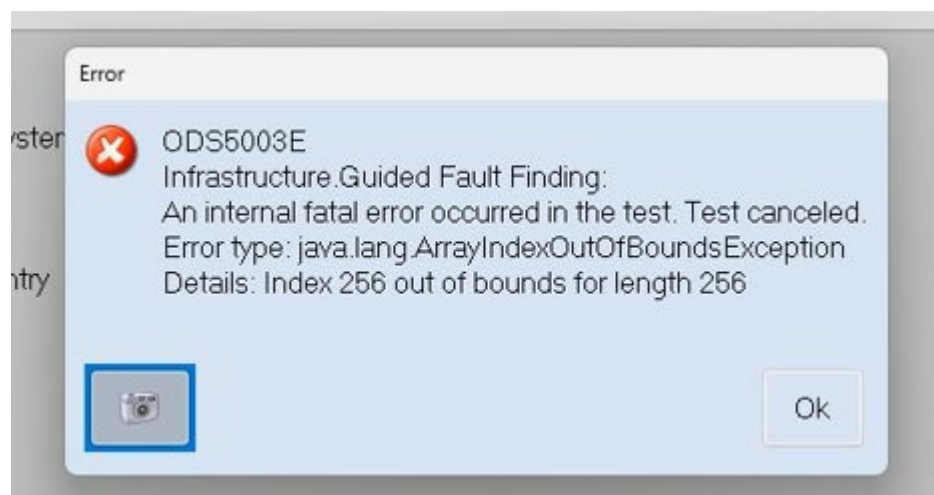

- Vehicle effected: All Audi vehicles
- Hotfix number: A_2.41.1_Korrekturversion2_41_1_20260526-144520
- ODIS software version needed for this hotfix: Audi brand version 2.41.1

Important:


We recommend installation of this hotfix on one diagnostic device ONLY. Hotfix must be removed immediately after performing the procedure.




Service Information

1.0 Download Hotfix

1. Open a **Web Browser** on the diagnostic device and log on to **AccessAudi.com**
2. Navigate to **Elsa2Go>Service References>Software/Hardware Updates**
3. Search for **AOS-26-25** Audi Brand 2.41.1 ODS5003E Errors Hotfix Zip File.
4. Click the **AOS-26-25** Audi Brand 2.41.1 ODS5003E Errors Hotfix Zip File icon  and **save** it to downloads folder.
5. Close your browser.
6. Browse to your downloads folder and unzip the hotfix zip file. **(Example file shown below)**

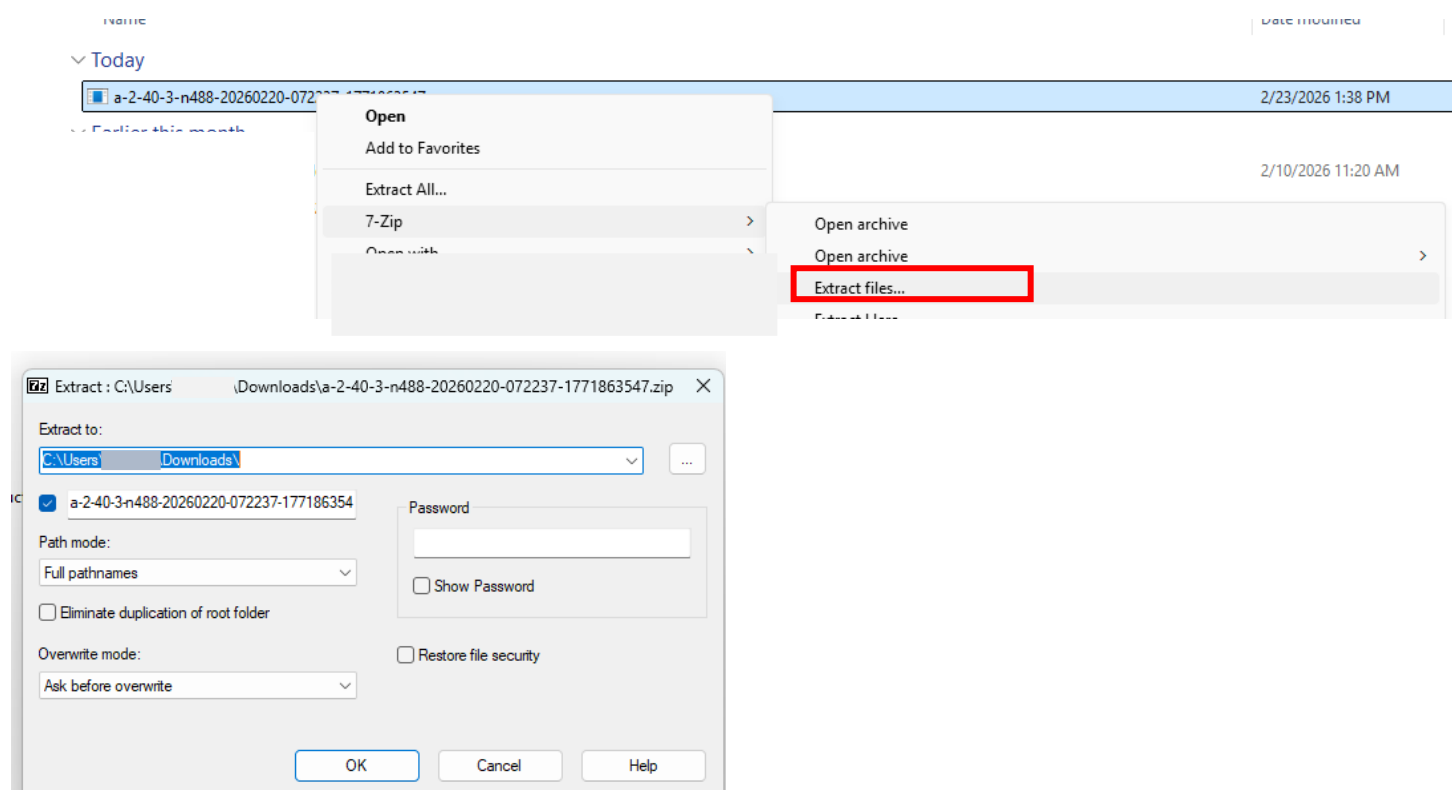

 7. After unzipping the file, double-click on the file to open it.




(continued)




Service Information

8. Right click the file (example only) name and select **Copy**:

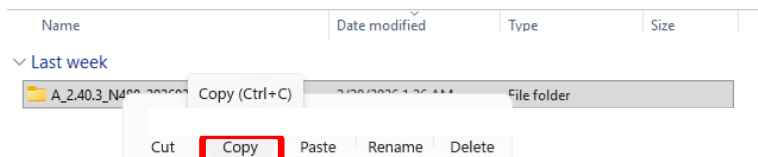


9. Navigate to your computer desktop, right click anywhere on the Windows desktop and select **Paste**. This file icon (example) must appear on the desktop:

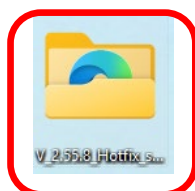

2.0 – Install Hotfix into ODIS Service


1. Open ODIS Service (“Run as Administrator”)
2. Expand the **Data** submenu and click **Download** (under **Hotfix**):

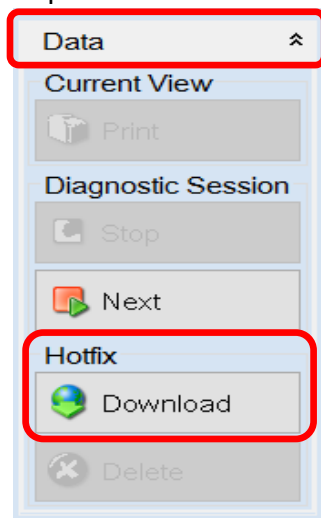




Service Information


3. Click **Continue**:

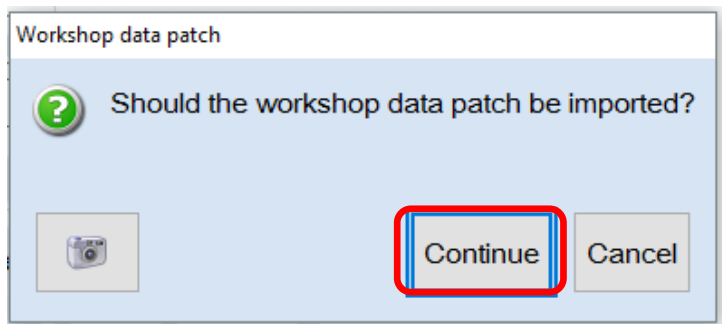

4. The Directory selection window will appear. Browse to and **highlight the Hotfix file** (*example only*), then click **Select Folder**:

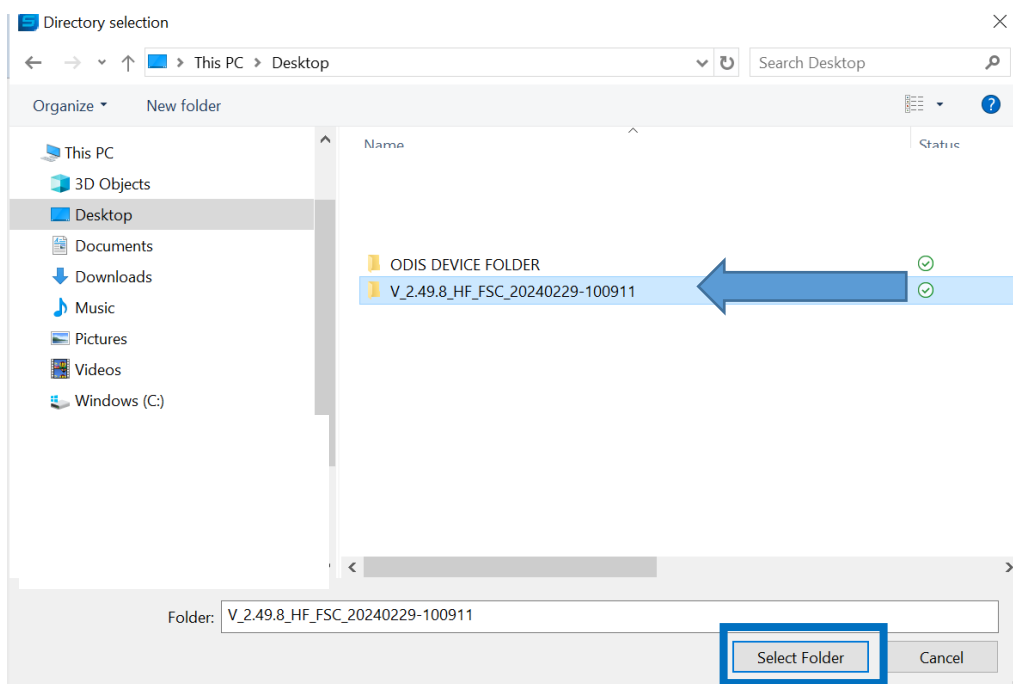

5. Click **OK**:

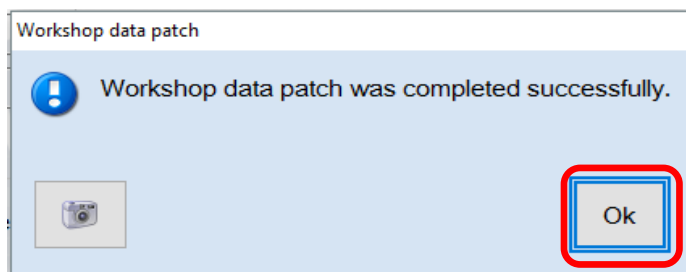

(continued)



Service Information


6. Perform the diagnostic procedure.

Important:

The Hotfix must be removed after performing the procedure. Failure to do so will cause other vehicle diagnostics sessions to malfunction.

3.0 – Uninstall the Hotfix from ODIS Service


1. Select **Erase** (under Hotfix), then **Continue**:

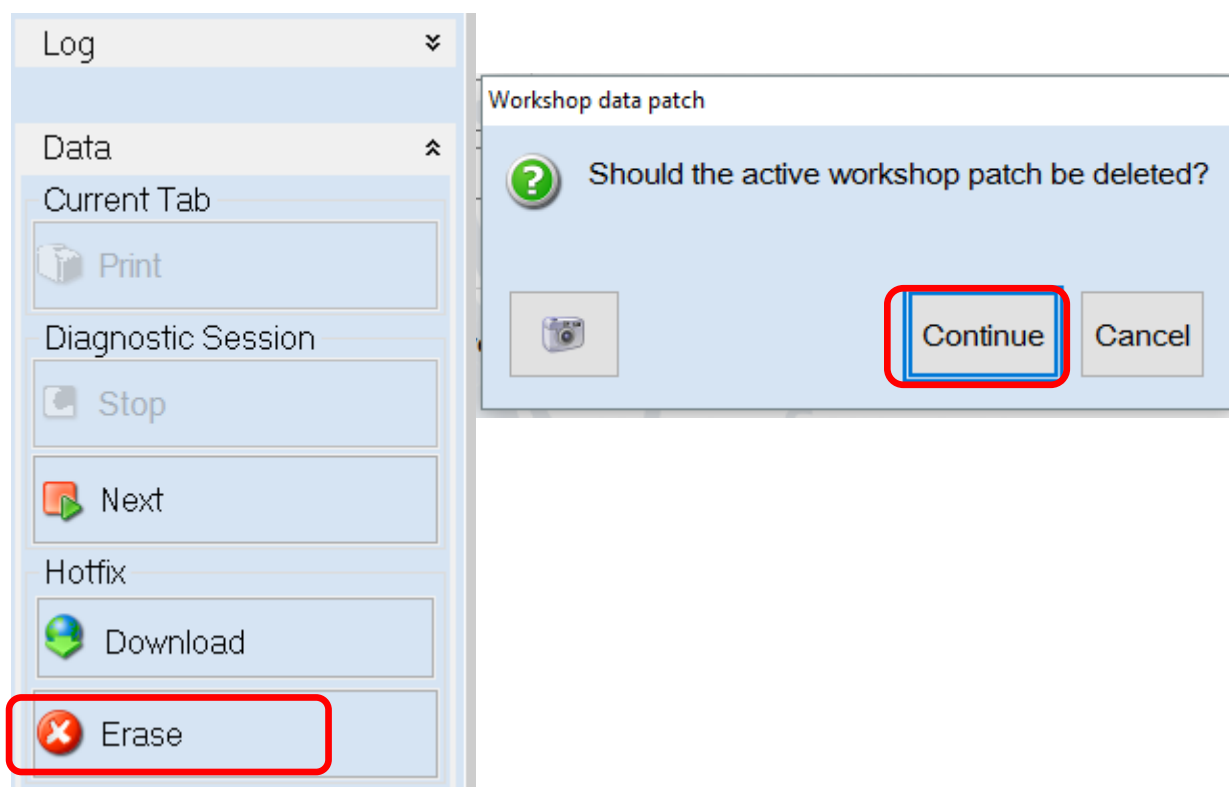

2. Click **OK** and close ODIS Service:



Service Information

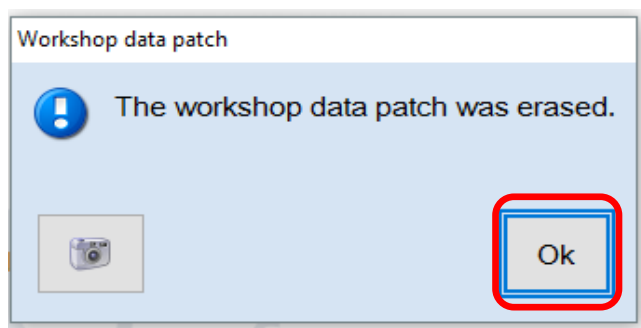

For questions or concerns, please reach out to David Provonche, 248-754-6091.

extern.dave.provonche@audi.com

Audi GFF / ODIS Validation / Service42 Research

VWGoA, Inc.

Product Quality & Technical Service