

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A5, and S5 (FU)	2025 – 2026	All	0044 Power steering With software: 0304
A6 Sportback e-tron, S6 Sportback e-tron, Q6 e-tron, Q6 Sportback e-tron, SQ6 e-tron, and SQ6 Sportback e-tron	2025		
A6 (FN)	2026		

REVISION HISTORY

Revision	Date	Purpose
2	-	Revised <i>Production Solution</i> (Updated Information)
1	01/28/2026	Initial publication

Customer states:

Power steering symbol lights up in instrument cluster.

Workshop findings:

The complaint is caused by the steering rack.

The following DTC is shown in diagnostic address 0044 (J500).

- **B200009 Control module faulty Component malfunction**
- **Symptom:** 13631508

and/or:

- **Symptom:** 5242900

Technical Background

Software issue.

Production Solution

Implemented at the end of January 2026 with steering software SW 0105.

Service

If TSB 2081477, *00 Service info: central overview of combined software update 03.11.00/C PPE/PPC - KD2** is available for the vehicle in question and the solution is shown, you do not need to replace the steering but should

instead perform the bulletin. The software in diagnostic address 0044 (J500) is updated from software 0304 to 0105 as a part of that TSB.

Replace the steering rack according to ETKA. A software solution is being prepared and will be available at the end of 2nd Quarter of 2026 at the earliest.

When billing, please always upload the diagnostic log to GFF paperless.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4835		
Damage Code:	0039		
Labor Operations:	Replace steering rack (A6 etron/Q6 etron)	4835 55xx	See SRT with associated operations
	Remove and install steering rack (A5/A6)	4835 19xx	See SRT with associated operations
Claim Comment:	As per TSB 2080711/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2080711**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.