



Connection offline

Technical Service Bulletin

Transaction No.: **2082008/1**

93 Control unit for activation of charging flap and charging socket - activation of LED lighting implausible - PPE

Release date: May 15, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A6 Sportback e-tron, S6 Sportback e-tron, Q6 e-tron, Q6 Sportback e-tron, SQ6 e-tron, and SQ6 Sportback e-tron	2027	All	813C – Charging communication control module 1 Software version: 0235 0241 0245 0250 0251 0304 0312 0325 813D – Charging communication control module 2 Software version: 0235 0241 0245 0250 0251 0304

Customer states:

- No complaint

Or

- There is a customer complaint resulting in replacement of control unit for activation of charging flap and charging socket (J1245 or J1246).

Workshop findings:

A guided function check of the LED module in the charging socket is performed in the context of a software update or replacement of the control unit for activation of charging flap and charging socket (J1245 or J1246). The basic setting / final control diagnosis of the LED lighting in cluster 6 deviates from the original function and it only lights up in green (instead of green / white / red).

Technical Background

Software issue in control unit for activation of charging flap and charging socket (J1245 or J1246).

Production Solution

Not applicable.

Service

During guided activation, the LED lighting on the affected vehicles (cluster 6) lights up continuously in green.

Replacing components will not fix the problem as there is a software issue in control unit J1245/J1246.

To test the functionality of the module, we recommend connecting a high-voltage charging connector and checking whether the LED module lights up in **white**. If this is the case, it can be assumed that it is working properly.

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9353		
Damage Code:	0039		
Labor Operations:	Check charging connection	9353 0199	10 TU
Claim Comment:	As per TSB 2082008/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

Additional Information

All part and service references provided in this TSB (**2082008**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.