



Connection offline

Technical Service Bulletin

Transaction No.: **2082146/1**

91 Service info: event memory entry B1BB*F0 in diagnostic address 005F // sound system

Release date: May 27, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
Q3	2026	All	With PR Code: 9VS

Customer states:

There is no customer complaint.

Workshop findings:

One or more of the following event memory entries are logged in diagnostic address 005F – control unit for information electronics, and there is no relevant customer complaint:

Diagnostic address	Event memory entry	Error status
005F- Information electronics 1	B1BB5F0 : External sound amplifier, speaker channel 1, short circuit to each other	Static
005F- Information electronics 1	B1BB9F0 : External sound amplifier, speaker channel 3, short circuit to each other	Intermittent
005F- Information electronics 1	B1BBBF0 : External sound amplifier, speaker channel 4, short circuit to each other	Intermittent
005F- Information electronics 1	B1BB7F0 : External sound amplifier, speaker channel 2, short circuit to each other	Intermittent
005F- Information electronics 1	B1BB7F0 : External sound amplifier, speaker channel 2, short circuit to each other	Static
005F- Information electronics 1	B1BB5F0 : External sound amplifier, speaker channel 1, short circuit to each other	Intermittent
005F- Information electronics 1	B1BB9F0 : External sound amplifier, speaker channel 3, short circuit to each other	Static
005F- Information electronics 1	B1BBBF0 : External sound amplifier, speaker channel 4, short circuit to each other	Static

Technical Background

A software issue can result in an event memory entry being logged without good reason.

Production Solution

Week 18/26 – introduction of generation 03S of sound amplifier.

Service

No repair needs to be carried out for this entry, provided that there is no customer complaint.

If there is a customer complaint regarding sound output from the loudspeakers, this TSB does not apply, and the vehicle must be repaired following Guided Fault Finding.

Warranty

-

Additional Information

All part and service references provided in this TSB (**2082146**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.