



# Service Bulletin

Bulletin No.: PIC6548A

Date: June, 2026

## PRELIMINARY INFORMATION

**Subject: Diagnostic Tip For - Cannot Switch Between Adaptive and Regular Cruise Control or Cruise Control Inoperative After Front Camera Replacement**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore GX	2024 - 2026		All	All	All	All
Buick	Envista	2024 - 2026		All	All	All	All
Chevrolet	Trailblazer	2024 - 2026		All	All	All	All
Chevrolet	Trax	2024 - 2026		All	All	All	All

<b>Involved Region or Country</b>	North America
<b>Additional Options (RPO)</b>	KSG, TQ5
<b>Condition</b>	Customer may comment that they cannot switch between adaptive and regular cruise or cruise control is inoperative. Customer may also comment that the Intellibeam headlamp feature is also inoperative. These conditions may be present after the front camera module was replaced.
<b>Cause</b>	Front Camera Module was not SPS configured after programming.

### Correction

Confirm vehicle will not switch between adaptive cruise and regular cruise by pressing and holding the cruise control cancel button.

If this fails, the technician will need to run the SPS Front Camera configuration.

<b>Version</b>	2
<b>Modified</b>	05/01/2024 - Created. 06/05/2026 - Updated Model Years

