



Service Bulletin

Bulletin No.: PIT6525

Date: June, 2026

PRELIMINARY INFORMATION

Subject: Drivers Seat Will Not Move

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	XT5	2026		ALL	ALL	ALL	ALL

Involved Region or Country	North America
Condition	Driver's seat will not move.
Cause	Possible open fuse F33DA due to shorted circuits in driver seat.

Correction

Inspect fuse F33DA located in the X51A IP fuse block.

If the fuse is open inspect the circuits to the M50D Seat Front Vertical Motor.

Inspect the circuits going to the vertical motor for being shorted together or shorted to ground.

It will be necessary to remove the seat and the seat cover to perform an inspection of these circuits.

Below is a photo from a Non- memory seat. Note the wire pinched below the bracket.



7149191

Routing of the harness may be different on a memory seat. Repair damaged circuits following proper procedure in SI. Power and Signal Distribution>Wire and Connector Repair> Repair Instructions.

If no damage to these circuits is found, inspect the entire seat wiring harness before reassembling and installing the seat.

If no damage is found to the circuits, follow SI diagnostics.

Version	1
Modified	06/05/2026 Created on

