



Mitsubishi Motors North America, Inc.
SERVICE - DEALER PDI - CAMPAIGN BULLETIN
(no customer notification)

SUBJECT: SERVICE / DEALER PDI CAMPAIGN ECU REFLASH	No: SC-26-001
	Version: 3
	Reason for change: Eligibility Clarification
	Date: May 29, 2026


TO: Mitsubishi Motors US and Puerto Rico Dealer Principals, General Managers, Sales Managers, Service Managers, Service Advisors, Parts Managers, Technicians and Warranty Administrators

AFFECTED VEHICLES

2026 Outlander with 4B40 Gen 2 Engine



Dealers must check 2026 Outlander VINS on the Warranty Superscreen for eligibility. If eligible, perform ECU reprogramming as shown below.

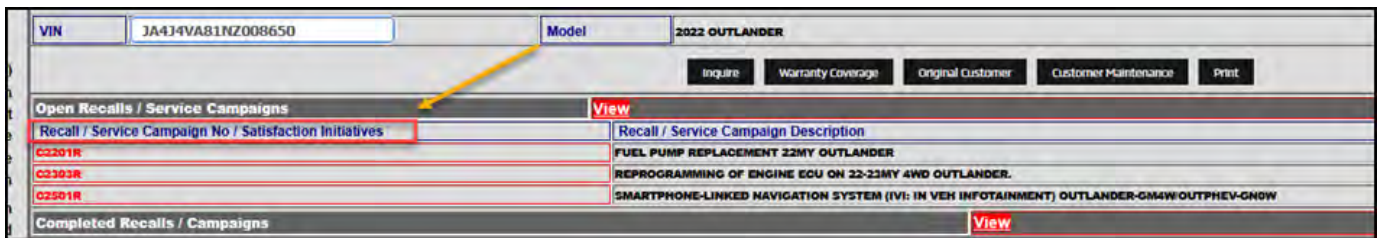

GROUP

14 - Cooling

CUSTOMER COMPLAINT

N/A

PURPOSE

MMNA has received reports from the field of customer concerns of the check engine light (CEL) on, with P0128-00 stored in the Engine Control Unit (ECU). If a CEL is present, Advanced Driver Assistance Systems (ADAS) may be restricted or disabled.

REMEDY

Ensure the MUT3-SE software number is at #978, and perform the procedure below:

Caution during reprogramming:

- Write down all the customer's electrical device settings such as A/C and radio before reprogramming and restore them after reprogramming
- Turn off all electrical devices to minimize the vehicle's electrical load. Also use an external power source to ensure that the vehicle battery maintains the specified voltage during reprogramming.
- Connect the MUT3-SE to an AC power source to prevent internal battery discharge.
- Before using, make sure the USB cable and MUT3-SE main harness are not damaged.
- Do not perform maintenance work in the engine room during reprogramming. If the connection between the ECU and Electronic Total Automotive Control System (ETACS) is lost, the cooling fan operates as fail-safe.

Model	Data No.				Remarks
Outlander	23761W36.1PN	23761W361P	23703W013P	23761W277P	2WD CRUISE CONTROL
	23761W36.2PN	23761W362P		23761W278P	
	23761W36.3PN	23761W363P		23761W279P	2WD MI-PILOT ASSIST
	23761W36.4PN	23761W364P		23761W280P	4WD CRUISE CONTROL
	23761W36.5PN	23761W365P		23761W281P	
	23761W36.6PN	23761W366P		23761W282P	4WD MI-PILOT ASSIST

WARRANTY

		Code A	Code B	Code C		Time
C2601P01	Reprogram of Engine ECU software	605	16	B	1	0.3 H

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly perform diagnosis and repairs on Mitsubishi vehicles, using Mitsubishi Motors approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply that the described repairs are covered under warranty. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.