



SSM 54918 Various Vehicles - Reduced Steering Assist And Steering Fault Message With DTC U2016:47 Stored In The PSCM

Some of the following vehicles:

- * 2025-2026 Mustang Mach-E vehicles built on or before 27-Jan-2026
- * 2025-2026 Maverick/Bronco Sport vehicles built on or before 20-Jan-2026
- * 2024-2026 Nautilus vehicles built on or before 02-Dec-2025
- * 2023-2026 Escape/Corsair

may exhibit reduced steering assist and a "Power Steering Assist Fault" message displayed in the instrument panel cluster (IPC) with the diagnostic trouble code (DTC) U2016:47 only, and no other steering DTCs stored in the power steering control module (PSCM).

To correct this condition, reprogram the PSCM using the latest software level of the Ford Diagnosis and Repair System (FDRS). For claiming, use causal part 3C529 and labor operations 3504E and PSCM. If a software update is not available for the PSCM, the PSCM is already at the latest software level. Refer to Workshop Manual (WSM), Section 211-02 for normal diagnostics.

If the vehicle does not exhibit any observable symptoms described above and the DTC is only present in continuous memory, this DTC should be ignored. No further service action is required, return the vehicle to the customer.