

Technical Service Bulletin (TSB)
Multiple Systems Repair Bundle Campaign

REFERENCE:	TSB: 08-234-26 GROUP: 08 - Electrical	Date:	June 3, 2026	REVISION:	—
VEHICLES AFFECTED:	2025 (BV) Jeep Renegade This bulletin applies to vehicles built on or after July 02, 2025 (MDH 0702XX) and on or before October 30, 2025 (MDH 10301XX).			MARKET APPLICABILITY: ☐ NA☐ MEA ☐ SA☒ IAP ☐ EE☐ CH NOTE: This bulletin applies to India & Asia Pacific markets.	
CUSTOMER SYMPTOM:	Customers must experience a Malfunction Indicator Lamp (MIL) illumination and the vehicle must exhibit/set the following Diagnostic Trouble Code (DTC): - P1A93-12 - Reversible Alternator : Power Electronics Fault - Motor Mode Out-Of-Action. Customers may also experience one or more of the following: - Front seat recliner motor is not working. - Ignition does not turn the engine off. - Fuel Pump Control Module (FPCM) - MIL ON. - Engine cylinder head cover is damaged. - Belt Start Generator (BSG) engine is not starting. - Front camera collision warning message is displayed on the Instrument Panel Cluster (IPC). - Headlamp low beam not working and the lens is stained. - Oil leaking from the Air Conditioning (A/C) compressor.				
CAUSE:	Manufacturing issue				

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-102, date of issue June 03, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves performing multiple inspections based on the listed Customer Symptoms and possibly performing the associated Operations procedure.

CLAIMS DATA:

Use the following labor operation numbers and time allowances for repairs:

Labor Description / Check point / Repairs	Operation	Labor Operation No.	Labor Time
Inspection	N/A	08-52-35-9A	1.0 Hrs.
Motor, Seat - Recliner - Replace - Right (0 - Introduction)	A	08-52-35-9B	0.7 Hrs.
Motor, Seat - Recliner - Replace - Left (0 - Introduction)	A	08-52-35-9C	0.7 Hrs.
Switch, Ignition - Replace (0 - Introduction)	B	08-52-35-9D	1.0 Hrs.
Module, Fuel Pump Control - Replace (0 - Introduction)	C	08-52-35-9E	0.3 Hrs.
Cover, Cylinder Head - Replace (0 - Introduction)	D	08-52-35-9F	0.8 Hrs.
Headlamp - Replace - Right (0 - Introduction)	E	08-52-35-9G	1.2 Hrs.
Headlamp - Replace - Left (0 - Introduction)	E	08-52-35-9H	1.2 Hrs.
BSG - Replace (0 - Introduction)	F	08-52-35-9I	1.1 Hrs.
Module, Forward Facing Camera - Replace (0 - Introduction)	G	08-52-35-9J	0.7 Hrs.
Compressor, Air Conditioning - Replace (0 - Introduction)	H	08-52-35-9K	1.6 Grs.
Failure Code	ZY	Service Action	

SPARE PARTS:

Part No.	Description	Notes
68270865AA	Motor, Power Seat	
735726507	Switch, Ignition	
68517001AB	Module, Fuel Pump Control	
46358116	Cover, Cylinder Head	
52200615	BSG	
68642213AA	Camera, Forward Facing	
68647298AA	Headlamp	
52166343	Compressor, Air Conditioning	
68224150GB	Lubricant, Compressor	
NPN	Refrigerant, R134A	

SPECIAL TOOLS/EQUIPMENT:

Description	Ref. No.	Notes
wiTECH or Equivalent	-	-
Leak Detector	EQ-10353143	
Ultraviolet (UV) Light	NPN	

INSPECTION:

Labor Description / Check point / Inspections	Operation
The following checks need to be performed prior to replacing the seat recliner motor: 1. Check for FR seat reclining operation three times.	Perform Operation Operation A if condition is confirmed.
The following checks need to be performed prior to replacing the ignition switch: 1. Check the Engine Start Stop (ESS) operation three times. 2. Confirm warning lights are illuminated.	Perform Operation Operation B if condition is confirmed.
The following checks need to be performed prior to replacing the FPCM: 1. Using the wiTECH, check for related DTCs in the FPCM.	Perform Operation C if condition is confirmed.
The following checks need to be performed prior to replacing the engine cylinder head cover. 1. Check for a crack in the engine oil cap.	Perform Operation D if condition is confirmed.
The following checks need to be performed prior to replacing the headlamp: 1. Confirm the headlamp lens is stained. 2. Confirm the low beam headlamp is inoperative.	Perform Operation E if condition is confirmed.

Labor Description / Check point / Inspections	Operation
The following checks need to be performed prior to replacing the BSG: 1. Check the ESS operation three times. 2. Confirm warning lights are illuminated. 3. Confirm DTC "P1A93 - Reversible Alternator : Power Electronics Fault - Motor Mode Out-Of-Action."is set.	Perform Operation F if condition is confirmed.
The following checks need to be performed prior to replacing the front camera: 1. Check for collision warning indicator or messages on the IPC.	Perform Operation G if condition is confirmed.
The following checks need to be performed prior to replacing the A/C compressor: 1. Use leak detector or UV dye to check for freon gas leakage at the A/C compressor.	Perform Operation H if condition is confirmed.

OPERATIONS:

Operation A

Replace the seat recliner motor. Refer to the detailed service procedures available in Dealer CONNECT> Service Library under: Service Info> 08 - Electrical / 8N - Power Systems / Power Seats / Motor, Seat / Removal and Installation.

Operation B

Replace the ignition switch. Refer to the detailed service procedures available in Dealer CONNECT> Service Library under: Service Info> 08 - Electrical / 8F - Engine Systems / Starting / Switch, Ignition / Removal and Installation.

Operation C

Replace the FPCM. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info> 08 - Electrical / 8E - Electronic Control Modules / Module, Fuel Pump Control / Removal and Installation.

Operation D

Replace the engine cylinder head cover. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: 09 - Engine / Cylinder Head / Cover(s), Cylinder Head / Removal and Installation.

Operation E

Replace the front headlamp. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info> 08 - Electrical / 8L - Lamps and Lighting / Lamps/Lighting - Exterior / Unit, Front Lamp / Removal and Installation.

Operation F

Replace the BSG. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info> 08 - Electrical / 8F - Engine Systems / Charging / Generator / Removal and Installation.

Operation G

Replace the front camera. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info> 08 - Electrical / 8E - Electronic Control Modules / Module, Forward Facing Camera (FFCM) / Removal and Installation.

Operation H

Replace the A/C compressor. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info> 24 - Heating and Air Conditioning / Plumbing / Compressor, A/C / Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.