



# Service Bulletin

Bulletin No.: PIP6121

Date: June, 2026

## PRELIMINARY INFORMATION

**Subject: Speedometer and/or Odometer Incorrect Following Internal Transmission Repair**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2025-2027		All	All	All	MRQ
GMC	Terrain	2025-2027		All	All	All	MRQ

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Speedometer and or Odometer incorrect following Internal Transmission repair.
<b>Cause</b>	Incorrect Final Drive and Transfer Gear Installed.

### Correction

Some customers may comment that the speedometer and/or odometer readings are incorrect following a final drive or transfer gear replacement. In some cases, the technician may also identify a mismatch in the fitment of the final drive and transfer gear assemblies.

Investigation has found an error in the parts catalog that may result in installation of an incorrect gear ratio component.

If this concern is encountered, please verify that Part Numbers 24292965 — GEAR ASM-FRT DIFF DRV PINION (W/ TRFER) and 24273376 — CARRIER ASM-FRT DIFF were ordered or installed on the vehicle. This can be done using previous repair order history or IVH in Global Connect.

If these part numbers were used in a previous repair or if these part numbers are currently on order for a current repair, make no repair attempts. Engineering is aware of the concern and corrective actions are being made.

This PI will be removed when the corrective actions have been completed.

<b>Version</b>	1
<b>Modified</b>	06/08/2026 - Created on.

