



Service Bulletin

Bulletin No.: PIT6527

Date: June, 2026

PRELIMINARY INFORMATION

Subject: DTC U0288 Symptom Byte 00 Lost Communication with DC/AC Converter Control Module

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado	2026		ALL	ALL	ALL	ALL
GMC	Canyon	2026		ALL	ALL	ALL	ALL

Involved Region or Country	North America
Additional Options (RPO)	Built without KI6 - RECEPTCL FRT CNSL RR - ELECTRICAL, 110 VOLT
Condition	Some technicians may find after performing a K9 Body Control Module: Programming and Setup procedure, DTC U0288.00 <Lost Communication with DC/AC Converter Control Module> is set as current in the K9 Body Control Module. Engineering is currently investigating. Do not reprogram nor replace any parts in attempt to resolve this DTC.
Cause	Note: DTC U0288 <Lost Communication with DC/AC Converter Control Module> should only set on vehicles equipped with KI6 120 V Power Outlet at Rear of Center Console. This DTC U0288 when set on vehicles not equipped with KI6 120 V Power Outlet at Rear of Center Console does not impact any other vehicle system and may be ignored.

Correction

The current concern may be a potential customer dissatisfier, but it is not a Safety Issue and does not create a substantial loss of use or value. The PI will be updated or replaced with a TSB once a determination has been made.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2881428*	Verify DTC U0288 Set On Truck Not Equipped with KI6 Center Console Rear 120 V Power Outlet	.2 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	06/10/2026 - Created on

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



**WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION**

Copyright 2026 General Motors. All Rights Reserved.