



GROUP	MODEL
ENG	2020-2025MY Telluride (ON)
NUMBER	DATE
266	June 2026

## TECHNICAL SERVICE BULLETIN

SUBJECT: **OIL FILTER HOUSING GASKET REPLACEMENT (WTY045)**

This bulletin provides information regarding the 'Warranty Extension Program (WTY045)' for the inspection and, if necessary, replacement of the oil filter housing gasket on certain 2020-2025 MY Telluride (ON) vehicles produced from January 9, 2019, through June 12, 2025. Under this program, the New Vehicle Warranty coverage for this condition is extended from 5 years / 60,000 miles to 15 years / 180,000 miles, whichever occurs first, starting from the date the vehicle was first put into service. Affected vehicles may develop an engine oil leak from the oil filter housing gasket. During the extended warranty period, inspect and, if necessary, replace the oil filter housing gasket at no cost to the customer. Follow the procedure in this publication to perform the inspection and replacement.



### NOTICE

**A Warranty Extension Campaign is based on a valid customer complaint during the extended warranty period with customer notification. There is no charge to the vehicle owner for this repair.**

Please confirm that all campaigns have been performed on the vehicle before returning it to the customer. Repair status for a VIN is provided on KDealer+ → Warranty → Coverage Inquiry Screen → Enter required information → Validate → refer to TSB, Campaign or Warranty Extension Section


This issue number is WTY045.

**Inspection Procedure:**

1. Raise the vehicle on a hoist.
2. Remove the oil drain cover (A).

**NOTICE**

If equipped, reference the appropriate installation sheet for removal and installation instructions of the Kia accessory skid plate first.

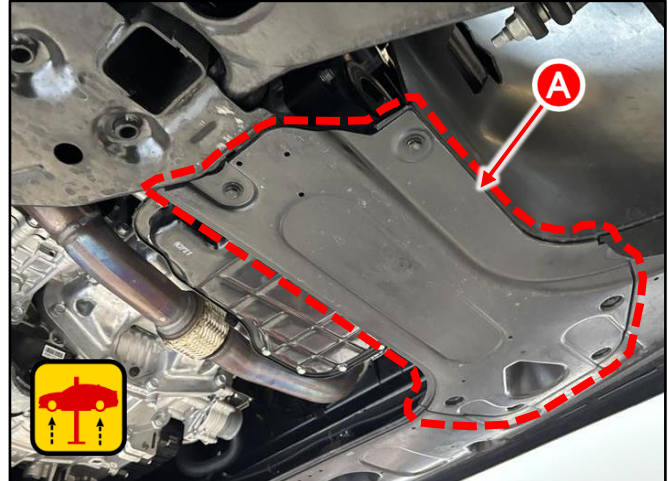



3. Inspect the oil filter housing assembly (B) engine block mounting area for oil leakage. **Is there visible oil leaking?**

- Engine oil is **NOT** leaking from the oil filter housing (OK).  
Inspection Only Op Code: 262A15I0

**NOTICE**

If engine oil is leaking, but not from the oil filter housing, claim the Inspection Only Op Code and follow normal diagnosis procedure to identify the source of oil leak.

- Engine oil **IS** leaking from the oil filter housing (NG). Proceed to the 'Repair Procedure' on page 3 to replace the oil filter housing gasket.

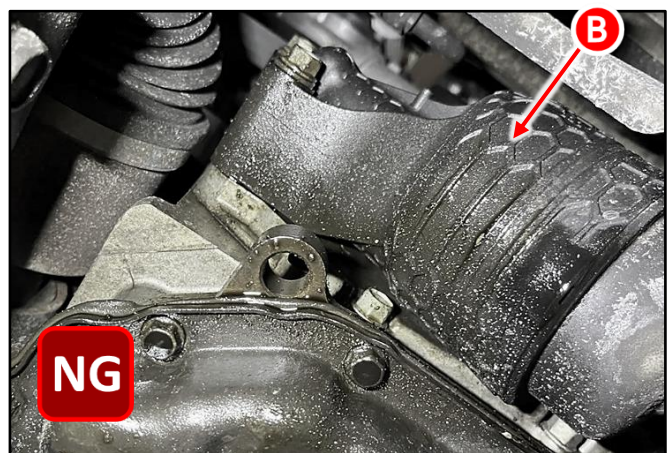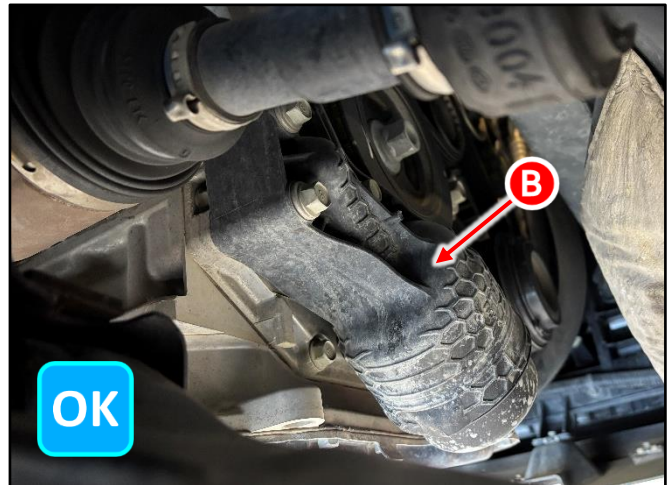

Removed oil filter housing shown above for reference purposes use only.

**Note:** Visible oil leaking from the oil filter housing mounting gasket area.

SUBJECT:

## OIL FILTER HOUSING GASKET REPLACEMENT (WTY045)

## Repair Procedure:

1. Place an oil drain container under the work area.
2. Remove the four (4) oil filter housing (B) mounting bolts and allow the housing oil to drain out into the container.

**Note:** Expect less than 1 qt. of engine oil to drain after the bolts are loose/removed from the mounting area.



2. Remove the existing oil filter housing gasket (C) from the assembly.
3. Remove any excess oil from the oil filter housing (B) and wipe it dry.
4. Install the new oil filter housing gasket (C) onto the outlined oil filter housing (B) area.

5. Wipe dry any excess oil from the outlined mounting surface on the engine block.
6. Reinstall the oil filter housing (B) with a new gasket (C) in the reverse order of removal.



**Tightening torque for  
Oil Filter Housing retaining bolts:  
14.5 - 15.9 lb.ft (19.6 - 21.6 N.m)**

7. Check the engine oil level on the dipstick and refill engine oil (5W-30) as needed.
8. 'Start' the engine and run for 15-30 seconds.
9. Shut engine 'OFF' and verify no engine oil is leaking from the oil filter housing (B).
10. Top-off the engine oil as needed.
11. Reinstall all other removed parts in the reverse order of removal.

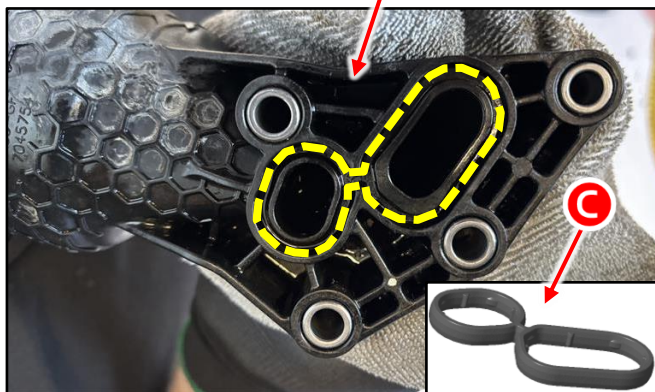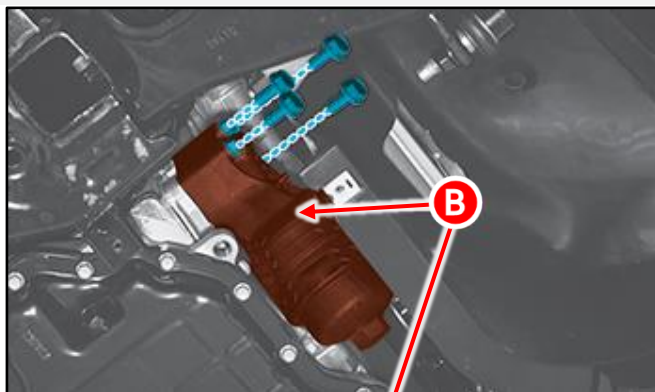


SUBJECT:

**OIL FILTER HOUSING GASKET REPLACEMENT (WTY045)****AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Telluride (ON)	January 9, 2019, to June 12, 2025

**REQUIRED PART:**

Part Name	Part Number	Figure	Qty.	Comments
Oil Filter Housing Gasket	26345 3LAA1QQK		1	
Engine Oil 5w-30 (Total Energy / Exxon Mobil)	T0530 QRT12A <u>or</u> UM050 CH035	N/A	1	Up to 3 Qts. Max

**Note:** Parts Eye will place replenishment orders based on the dealers' on-hand supply. Please refer to Parts bulletin [PB MI-25-08](#) for information related to Parts Eye Campaign ordering.

**WARRANTY INFORMATION:**

**N Code: L24 C Code: ZZ3**

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
W	26345 3LAA1	0	(WTY045) Oil Filter Housing Leak Inspection Only (OK)	262A15I0	0.3 M/H	N/A	0
			(WTY045) Oil Filter Housing Leak Inspection (NG) + Gasket Replacement + Engine Oil Top-Off	262A15R0	0.6 M/H	26345 3LAA1QQK	1
						T0530 QRT12A or UM050 CH035	Up to 3qts

**Note:** Refer to [Warranty Bulletin 2604](#) for claim submission procedures. For Substitute Transportation policy, please refer to [Service Policy and Procedures Manual \(SPPM\) 6.11 "Kia Substitute Transportation"](#).