



## **SSM 54940 2021-2026 F-150 - DTC U2100:00 Stored In The Trailer Control Module**

Some 2021-2026 F-150 vehicles may exhibit a U2100:00 diagnostic trouble code (DTC) for initial configuration incomplete stored in the trailer control module (TRM). This may be due to the vehicle having a Ford accessory trailer brake kit installed without being programmed following the included instructions. If the vehicle was built with minor feature code FDDAA and a trailer brake gain switch is present in the stock location in the instrument panel, a Ford Accessory trailer brake kit has been installed on the vehicle. If a Ford Accessory trailer brake kit is present, download and run the "TRM - Towbar Configuration" application using the latest software level of the Ford Diagnosis and Repair System (FDRS) scan tool.

To confirm a vehicle is built with a certain minor feature code, review the build information by double-clicking the vehicle identification number (VIN) in the upper left corner in the Professional Technician System (PTS).