



SSM 54941 2022-2024 F-150 - False Perimeter Alarm Activation

Some 2022-2024 F-150 vehicles equipped with a perimeter alarm may exhibit a false alarm activation intermittently. This may be due to the software in the body control module (BCM). Monitor the BCM alarm event parameter identifications (PID). If ALARM_EVT_1/2/3/4 show a value of Intrusion Sensor, reprogram the BCM using the latest software level of the Ford Diagnosis and Repair System (FDRS) diagnostic scan tool. For claiming, use causal part 15604 and labor operations 12651D and BCM.