

TECHNICAL SERVICE BULLETIN



FOREST RIVER

DEPARTMENT OF COMPLIANCE
VEHICLE SAFETY AND RECALL MANAGEMENT
PO Box 30
MIDDLEBURY, INDIANA 46540-9218

TECHNICAL SERVICE BULLETIN: 224-2070
SERVICE CAMPAIGN: 001298

- o *Integrity*
- o *Safety*
- o *Quality*
- o *Customer Service*

<<VIN>>
<<OWNER NAME/DEALERNAME>>
<<ADDRESS>>
<<CITY>>, <<ST>> <<ZIP-XXX>>

June 2026

Dear Forest River Customer:

Forest River is alerting you to an issue involving certain 2026 Coachmen Remote Travel Trailer Recreational Vehicles. Please see the information below, which describes the issue and provides you with details on the steps you should take to have your vehicle repaired.

WHAT IS THE ISSUE?

The 12V ground wires from the solar panel and solar controller were tied into the 12V distribution panel ground bar instead of being tied together to have a closed loop system.

DEALERS: WHAT SHOULD YOU DO?

Remedy Instructions can be found on Dealer Connect.

HELPFUL CONTACT INFORMATION:

CONTACT	PHONE
CUSTOMER SERVICE	(574) 825-8205


DEALER REPAIR CODES: Dealer Connect

TSB NUMBER	REPAIR CODE	DESCRIPTION	ALLOWABLE HOUR(S)
224-2070	SB-386-05-00-004838	INSPECTION ONLY	.10 HRS
224-2070	SB-386-09-11-004839	INSPECTION AND REMEDY	.50 HRS

Sincerely,

Forest River, Inc.
Office of Corporate Compliance

TECHNICAL SERVICE BULLETIN 224-2070 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): MANY Model(s): REMOTE Model Year(s): 2026	Repair Code: SB-386-09-11-004839 Allotted Time:0.50 HR Inspection Code: SB-386-05-00-004838 Allotted Time:0.10 HR
	Concern: The 12V ground wires from the solar panel and solar controller were tied into the 12V distribution panel ground bar instead of being tied together to have a closed loop system.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Number: N/A Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

1. LOCATE THE DISTRIBUTION PANEL IN THE UNIT.
2. REMOVE THE DISTRIBUTION PANEL COVER AND SCREWS HOLDING IT INTO THE CABINET
3. PULL DISTRIBUTION PANEL OUT FROM THE OPENING AND LOCATE THE TWO (2) BLUE/WHITE 10 GAUGE WIRES
 - a. ONE WILL BE COMING THROUGH THE FLOOR HOLE AND ONE WILL BE COMING FROM THE ROOF THROUGH THE CABINET
4. AFTER LOCATING THE BLUE/WHITE 10 GAUGE WIRES, FIND THE WHITE SIDE OF THE WIRES THAT ARE CONNECTED TO THE GROUND BAR
5. LOOSEN THE SCREWS ON THE GROUND BAR AND REMOVE THE TWO (2) WHITE 10 GAUGE WIRES THAT PAIR WITH THE BLUE WIRES
6. AFTER THE WHITE WIRES HAVE BEEN REMOVED, BELL CAP OR WAGO CONNECT THE TWO (2) WHITE WIRES TOGETHER
7. AFTER WIRES ARE PROPERLY CONNECTED AND SECURED, INSERT DISTRIBUTION PANEL BACK INTO CABINET OPENING
 - a. SCREW DISTRIBUTION PANEL BACK INTO CABINET
 - b. PUT COVER BACK ONTO DISTRIBUTION PANEL
8. CLAIM REPAIR CODE

TECHNICAL SERVICE BULLETIN



DEPARTMENT OF COMPLIANCE
VEHICLE SAFETY AND RECALL MANAGEMENT
PO Box 30
MIDDLEBURY, INDIANA 46540-9218

Technical Service Bulletin: 224-2070

- o Integrity
- o Safety
- o Quality
- o Customer Service

<<VIN>>
<<OWNER NAME/DEALERNAME>>
<<ADDRESS>>
<<CITY>>, <<ST>> <<ZIP-XXX>>

June 2026

This Notice applies to your vehicle VIN listed above.

Dear Forest River Customer,

Forest River is alerting you to an issue involving certain 2026 Coachmen Remote Travel Trailer Recreational Vehicles. Please see the information below, which describes the issue and provides you with details on the steps you should take to have your vehicle repaired.

WHAT IS THE ISSUE?

The 12V ground wires from the solar panel and solar controller were tied into the 12V distribution panel ground bar instead of being tied together to have a closed loop system.

OWNERS: WHAT SHOULD YOU DO?

Please contact your dealer immediately and request a service appointment to schedule the free repair. The vehicle Owner is responsible for arranging to have the work completed. Please state you have been notified by Forest River of the issue and provide the TSB number (located at the top of this page) to the dealership. It is also helpful to give the dealership a copy of this letter when you take your vehicle in for the repair.

You may visit www.forestriverinc.com to search for dealer locations.

HOW LONG WILL THE REMEDY PROCESS TAKE?

The estimated time of repair is 0.50 hours. However, the dealership may need to keep your vehicle or schedule an appointment with you for a later date to fit into their regular service schedule.

HELPFUL CONTACT INFORMATION:

CONTACT	PHONE
CUSTOMER SERVICE	(574) 825-8205

WHAT IF YOU HAVE PREVIOUSLY PAID FOR REPAIRS TO YOUR VEHICLE FOR THIS PARTICULAR CONDITION?

If you have already paid for a repair that is within the scope of this service bulletin, you may be eligible for a refund of previously paid repairs. Refunds will only be provided within the scope of this Technical Service Bulletin.

Please send the service invoice to the following address:

Coachmen Remote
Attn: WARRANTY MANAGER
423 N Main St
Middlebury, IN 46540

Sincerely,

Forest River, Inc.
Office of Corporate Compliance