

Technical Service Bulletin

Circulate To:	Service Manager	x	Parts Manager		Series:	Momentum
	Warranty Admin	x	Technician	x	Model:	Line 12 built TT's only
	Sales Manager				Build Date	*10/2025

Concern: It has been identified that certain Line 12 Momentum TT's may have the Happijac top bunk L-brackets installed in an inverted (upside-down) orientation. The reduced clearance condition can cause mechanical interference at the top of travel, preventing the bunk from properly disengaging from the locking mechanism.

Remedy: Inspect the orientation of the Happijac top bunk L-brackets. If brackets are found to be inverted, remove and reinstall in the correct orientation per manufacturer specifications to restore proper clearance and ensure normal disengagement of the locking mechanism at full upward travel.


Flat Rate: 920028 - Happijack Bed Bracket - Bed lift stuck in lifted position

Tools: Phillips screwdriver

Parts: n/a

- Step 1:** To correct this, you will need to pull the cotter pin out of the clevis pin
- Step 2:** Lift the bed decking rail to get to the mounting screws on the bracket and back out the screws.
- Step 3:** Flip the bracket to its correct position, making sure to keep the spacer block in place, reinstall both screws.
- Step 4:** Lower bed decking back into place and reinstall washer and cotter pin into the clevis pin. Repeat process on all 4 brackets.

Incorrect install examples:

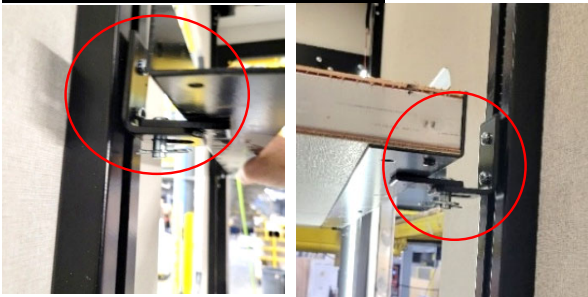

Correct install:



LCI / Lippert example install:

