

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 826 – MC20 Cielo Door Latch Module Software Update



DATE: June 24, 2026

Certain Maserati vehicles listed in MODISCS+ are involved in a Rapid Update to SW updates to the LSMD and LSMP modules.

VEHICLES INVOLVED: (M241) MC20 Cielo MY23 thru MY26

A software timing issue has been identified in the **LSMD (Latch Smart Module Driver)** and **LSMP (Latch Smart Module Passenger)** modules. During door opening in **Passive Entry mode**, the system may not perform the required **window short drop** correctly. As a result, the door may be difficult to open.

Required Action

Update the software in both the **LSMD** and **LSMP** modules using the procedure below.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure

Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.

Prerequisites Before Beginning the Software Update

Before starting the update procedure, ensure the following conditions are met:

- **Connect the E-XTEQ MAXIMUS** to maintain the required system voltage and current throughout the update. *(Required)*
- **Ignition ON, Engine OFF.**
- **Vehicle parked with the SGW unlocked.**
- **MD-Evo scan tool software version 9.8.2 or newer** must be installed.
- **Follow all on-screen prompts provided by the MD-Evo scan tool** during the procedure.

LSMD Software Update Procedure

- 1) With the engine OFF and the battery charger connected, launch the EVO Sw.
- 2) Navigate to **LSMD – ECU Programming** and perform the software update.

Software version to be installed (or newer)

F188 New
670362248

LSMP Software Update Procedure

- 3) After the **LSMD** SW update completes, navigate to **LSMP – ECU Programming** and perform the software update.

Software version to be installed (or newer)

F188 New
670354892

- 4) After the **LSMP** SW update completes, Clear all residual DTCs in all modules.
- 5) Once complete, the vehicle can be released.

Warranty Claim Information

Fill in the Warranty Claim as follows:

Description	Code
Rapid Update Number	826
Warranty Code	23
Fault Code	063
Component Code	9.31.007
Operation Code	
<ul style="list-style-type: none"> ▪ LSMD SW Update ▪ LSMP SW Update 	9.31.007.A (0,20h) 9.31.008.A (0,20h)