

REFERENCE:	TSB: 09-012-26 REV. A GROUP: 09 - Engine	Date:	June 18, 2026	REVISION:	09-012-26
VEHICLES AFFECTED:	2026 (DT) RAM 1500 Pickup 2026 (WS) Grand Wagoneer/Wagoneer This bulletin applies to vehicles built on or after **March 27, 2026 (MDH 0327XX) and on or before April 14, 2026 (MDH 0414XX)** equipped with the 3.0L I6 Hurricane SO Twin Turbo ESS (Sales Code EFH).			MARKET APPLICABILITY: <input checked="" type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> EE <input type="checkbox"/> IAP <input type="checkbox"/> SA <input type="checkbox"/> CH NOTE: This bulletin applies to North America markets.	
CUSTOMER SYMPTOM:	Customers may experience the following: <ul style="list-style-type: none"> 'Low Oil Level' message on in the Instrument Panel Cluster (IPC). Oil Leak. 				
CAUSE:	Casting Issue				

This bulletin supersedes Technical Service Bulletin (TSB) 09-012-26, date of issue June 16, 2026, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include updated build dates and the inclusion of Floor Plan Reimbursement information to the Claims Data section.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-112, date of issue June 16, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

REPAIR SUMMARY:

This bulletin involves replacing the engine oil pan.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
09-60-01-98	Pan, Engine Oil - Replace DT (1 - Semi-Skilled)	1 - Engine Repair and Performance	3.0 Hrs.
09-60-01-99	Pan, Engine Oil - Replace WS (1 - Semi-Skilled)	1 - Engine Repair and Performance	3.1 Hrs.
95-95-95-97	Floor Plan Allowance	1 - Engine Repair and Performance	Calculate See Table Below
Failure Code	ZY	Service Action	

****Floor Plan Reimbursement represents the vehicle's average daily allowance (see table below) multiplied by the number of days the vehicle was in dealer inventory and not available for sale. This reimbursement is limited to the number of days from the date of the stop sale to the date that the remedy was made available. Note: If the vehicle was received by your dealership (KZX date) AFTER the stop sale date, you will use the KZX date instead of the stop sale date. For this RSU, the stop sale was initiated on 05/01/2026 and the remedy was made available on 06/17/2026, therefore, the number of days cannot exceed 48 days.**

NOTE: See the Warranty Administration Manual for complete claim processing instructions.**

Vehicle	Average Daily Allowance
2026 (DT) RAM 1500 Pickup	\$11.66
2026 (WS) Grand Wagoneer/Wagoneer	\$13.70

SPARE PARTS:

Qty	Part No.	Description	Notes
1	68359141AG	Oil Pan Assembly	–
8	68523969AA	0W-20 Full Synthetic Engine Oil	
2	06506557AA	NUT AND WASHER, Hex Lock, M14x1.50	(Upper Ball Joint Nut)
4	06506497AA	BOLT, Hex Flange Head Locking	(Driveshaft To Front Axle Flange Bolts)
1	06508531AA	SCREW, Hex Flange Head, M10x1.50x39.00	Intermediate Shaft to Steering Gear (Steering Gear Pinch Bolt)
2	06513404AA	NUT, Hex Lock, M12X1.25X22.00	(Halfshaft Hub Nut)
2	06513461AA	NUT, Outer Ball Stud to Front Knuckle	(Tie Rod End Nut)
0.2	04883971AC	Engine Sealant RTV Silicone Rubber Adhesive	(Quantity as needed probably 1 per 5 VINs both WS and DT use it)
2	06510880AA	Screw	

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. **This RSU only applies to vehicles on the RSU VIN list.**

REPAIR PROCEDURE:

1. Replace the engine oil pan. Refer to the detailed service procedures listed in DealerCONNECT>Service Library>Service Info>under: 09 - Engine, 3.0L GMET6 / Lubrication / Pan, Oil / Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.