



Rosenbauer America Technical Service Campaign TSC26001

THIS IS NOT A RECALL

Subject: The power steering cooler may begin to leak on the low-pressure side of the system. This fault will need to be inspected and corrected if any seepage is present

Problem: Power steering cooler fittings have an inconsistent machined edge; this edge prevents the O-ring from sealing resulting in a slow seepage.

Applies To: Certain 2019-2026 Rosenbauer trucks have been flagged as possible candidates. Rosenbauer will be supplying a list to service partners and notifying customers.

Assistance Needed: Dealers to follow the Technical Service Campaign instructions and inspect the listed candidates for faulty power steering coolers. If known leaks are present, submit a CRM ticket with an image of the leaking cooler fittings.

Resolution: If this problem is found, a replacement Setrab cooler with higher quality standards and machining will be supplied at no cost to customers. This correction does not change the connected hoses and does not require a full power steering drain.

Note: This is a technical service campaign and is not a recall.

Contact recalls@rosenbaueramerica.com with questions.