



Thor Motor Coach Technical Service Bulletin

TSB #	TSB 26-04		
Description/Title:	Radio fuse		
Affected Product Line(s):	Certain model year 2025 Eddie Bauer 2025-27 Axis 2025-27 Vegas		
Service Campaign # :	RC000341		
Codes:	Inspect with Repair: TMCTS10130J	Document Date:	7/6/2026
Time Allowed:	Inspect with Repair: 0.2	Document Revision:	A

Issue:

It has been discovered the dash radio in-line fuse was installed with the incorrect fuse size. Production installed a 5A fuse when it should be a 15A fuse. The undersized fuse greatly reduces the surge allowance during normal operation. The wire for the dash radio is 14 gauge and is compatible with a 15A fuse.

Part(s) Required:

- 15A fuse

Instructions:


1. Gain access to the house batteries located under the inside stepwell of the entry door.



2. Locate the in-line fuses connected to the positive (+) side of the battery.



3. The fuse holder labeled '5' will need the 5A fuse changed to a 15A fuse. Verify the wire inside the loom is yellow, which represents the dash radio.

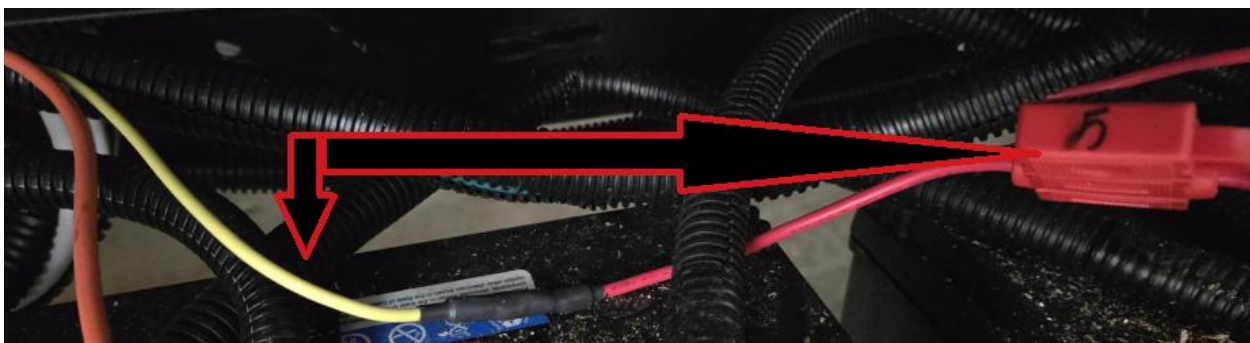

4. Once the fuse has been changed to 15A, add a '1' before the '5'.

