



Technical Service Bulletin

Technical Service Bulletin: TSB230020

Released Date: 16-Jun-2026

Variable Geometry Turbocharger (VGT) Electronic Actuator Installation and Calibration Did Not Pass

Variable Geometry Turbocharger (VGT) Electronic Actuator Installation and Calibration Did Not Pass

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- B6.7 CM2350 B121B
- B6.7 CM2350 B135B
- B6.7 CM2350 B136C
- B6.7 CM2350 B148B Stop-Start Applications
- B6.7 CM2350 B157C
- B6.7 CM2450 B155B
- ISB6.7 CM2350 B101
- ISB6.7 CM2350 B103
- ISB6.7 CM2350 B142
- ISL9 CM2350 L101
- ISL9 CM2350 L111
- L9 CM2350 L116B
- L9 CM2350 L119B
- L9 CM2350 L120C
- L9 CM2350 L123B
- L9 CM2350 L129C
- L9 CM2350 L133C
- L9 CM2450 L126B
- X12 CM2350 X119B
- X12 CM2450 X137B
- X15 CM2350 X114B
- X15 CM2350 X116B

- X15 CM2450 X124B
- X15 CM2450 X134B
- X15 CM2450 X142B

Issue Summary

Variable geometry turbocharger (VGT) actuators have been improperly diagnosed as faulty after incorrect install or calibration steps were performed.

Symptom:

- “Failed” message received on VGT Electronic Actuator Installation and Calibration test in INSITE™ electronic service tool
- Active Fault Code 6432, 2449, or 1898

Root Causes:

- The VGT actuator was mounted to the turbocharger during the Install Actuator step.
- Improper alignment of turbocharger sector gear on the turbocharger while mounting the VGT electronic actuator.

Resolution

- See corresponding Service Manual. Reference Procedure 010-134 in Section 10. Reference video link below.
- If VGT electronic actuator Install or Calibrate steps do **not** pass, the installation procedure **must** be started over from the beginning.
- The VGT electronic actuator **must** be removed, unplugged for 30 seconds, and the turbocharger sector gear placed into the correct fully clockwise position.
- If unsuccessful after two attempts, contact 1-800-CUMMINS™ to escalate this issue.

Note : http://tsb.cumminsvirtualcollege.com/230020_en.aspx
(http://tsb.cumminsvirtualcollege.com/230020_en.aspx)

Document History

Date	Details
2023-2-6	Module Created
2023-3-16	Added Fault Code 1898.
2023-3-31	Added video link.
2026-6-16	Added to Product Affected

