



Connection offline

Technical Service Bulletin

Transaction No.: 2080911/1

90-26-01 - Area View Camera Inoperative

Condition

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas, Atlas Cross Sport	2024 – 2026	All	All	NA	NA

Revision Table			
Instance Number	Published Date	Version Number	Reason for Update
2080911/1	06/16/2026	90-26-01	Original publication

 NOTICE
This technical bulletin must be read in its entirety before attempting the software update. – If software updates or flash campaigns/actions are performed on a vehicle, a charger with at least 70A charging current MUST be used in order to avoid problems during the updates and flash campaigns /actions. – This technical bulletin only applies to the vehicle groups specified above with PR code KA6.

The customer may report that the Area View Camera image(s) are not visible in the infotainment display. This condition may be accompanied by an error message in the MFI.

Technical Background

This procedure resolves the concerns specified above by updating the Peripheral Camera Module -J928- to the latest software level (0324).

Production Solution

NA

Service

Software Checking Procedure

Connect MTRMSP0702 battery maintainer/charger to the vehicle's 12 volt battery.

Switch the ignition to the ON position.

Check the current software level using the following steps (depending on the system):

Connect ODIS to the vehicle’s Data Link Connector (DLC)

Initiate Guided Fault Finding (GFF) and allow the tester to complete interrogation of all vehicle modules.

Once interrogation is complete, observe the SW level displayed for address 006C, Rear view camera system.

00BB	0	Rear drivers side door electronics (5Q0959595L 0350 TSG HFS)
003C	3	Lane change assistance (003C - Lane change assistance - rear radar Gen3) (2Q0907686G 0287 HRE_Master)
006C	0	Rear view camera system (006C - Peripheral camera) (5WA907556J 0324 TV eEntry)
00BC	0	Rear passenger side door electronics (5Q0959595L 0350 TSG HBFS)
006D	0	Rear lid electronics (006D - Rear Lid Electronics) (5WB959107A 0433 HDSG-Modul)

Figure 1.

If the SW level is greater than or equal to **0324**, this work procedure does not apply.

If the SW level is lower than **0324**, continue with this work procedure.

Software Update Procedure

- Click on the “Special Functions” tab.
- Select “Adapting software”.
- Select option 2 “SVM via action code”.
- When prompted, enter action code **5295**.
- Follow all prompts through completion of the test plan.
- Once the test plan is completed, exit GFF.

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Atlas, Atlas Cross Sport	2024 – 2026	All	All	All	All
SAGA Coding					
Claim Type:	Use applicable Claim Type ¹⁾				
Service Number:	Damage Code	HST		Damage Location (Depends on Service No.)	

9084	0039	--	--
Parts Manufacturer	Atlas, Atlas Cross Sport		WG8 2)
Labor Operation 3) : ODIS set-up with 12V battery charger connection		01500010 = See Elsa for latest time units.	
Labor Operation 3) : Update programming SVM		See GFF Time expenditure	
Diagnostic Time 4)			
GFF Time expenditure	01500060 = Actual GFF print out. 70 TU max.	YES	
Road Test	01210002 = 00 TU 01210004 = 00 TU	NO	
Technical Diagnosis	01320000 = 00 TU max.	NO	
Claim Comment: Input “As per Technical Bulletin 2080911” in comment section of Warranty Claim.			
1) Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only			
2) Code per warranty vendor code policy.			
3) Labor Time Units (TUs) are subject to change with ELSA updates.			
4) Documentation required per Warranty Policies and Procedures Manual.			

Required Parts and Tools

Tool Description	Tool Number
Midtronics Battery Maintainer	MYRMSP0702
VAS Diagnostic Tool	VAS 6150/X & VAS 6160/X with ODIS Service with current online updates

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2026 Volkswagen Group of America, Inc. / Volkswagen Group Canada Inc., All rights reserved.
Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc. / Volkswagen Group Canada Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval

system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.