



Connection offline

Technical Service Bulletin

Transaction No.: **2028985/13**

37 Transmission warning message in cluster (P074100 stored in TCM) - 0BK gearbox

Release date: Jun 23, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A4, A4 Avant, A5 Cabriolet, A6, A7, A8, and Q5	2012 – 2014	All	0BK transmission (AL551)
allroad, and S8	2013 – 2014		

REVISION HISTORY		
Revision	Date	Purpose
13	-	Revised header (Updated models) Revised <i>Service</i> (Updated verbiage) Revised <i>Warranty</i> (Updated warranty table) Revised <i>Additional Information</i> (Added statement)
12	07/01/2014	Revised <i>Service</i> (Changed SVM codes and software versions)
11	5/1/2014	Revised header (Added MY 2014 A4, A5, A6, Q5, and allroad) Revised <i>Service</i> (Changed SVM codes and software versions) Revised <i>Warranty</i> (Updated Labor Operations)

Customer states:

The gearbox warning lamp is on in the instrument cluster. After the ignition is switched off and on again, there are no further complaints and the warning is no longer shown.

Workshop findings:

The following event memory entries (static/intermittent) are logged in the gearbox electronics control unit (diagnostic address 0002):

- **P074100:** Torque Converter Clutch Circuit Performance or Stuck Off
 - Symptom: 22993



To ensure that the issue can be clearly assigned to this TSB, it must be ensured that the ATF level is OK and that there are no leaks on the gearbox.

Technical Background

Not applicable.

Production Solution

Not applicable.

Service

Taking all aspects specified above into account, try to reproduce the customer complaint (based on the customer statement/workshop findings and technical background) so that it can be clearly assigned to this TSB. The following measure must only be carried out if all the criteria (model/type, model year, chassis number, engine/gearbox code, PR number(s), part number, software version, etc.) apply exactly. Otherwise, this measure will not resolve the issue and repeat repairs may be necessary. In such a case, we may reject the warranty claim and charge back the cost of the parts.

If the complaint described in this TSB can be reproduced, update the gearbox software with **SVM code 02A072**.

Compare the actual software version with the target software version table before performing this. Vehicles with a software version that already corresponds to or exceeds the target version are exempt from this measure.

A4/A5

Old Software part number	Old Software version	New Software part number	New Software version
8K0.927.158 K	*	8K0.927.158 K	1014
8K0.927.158 Q	*	8K0.927.158 Q	1004
8K0.927.158 S	*	8K0.927.158 S	1006
8K0.927.158 T	*	8K0.927.158 T	1005

Q5

Old Software part number	Old Software version	New Software part number	New Software version
8R1.927.158 C	*	8R1.927.158 C	1006
8R1.927.158 D	*	8R1.927.158 D	2004
8R0.927.158 E	*	8R0.927.158 E	1014
8R0.927.158 M	*	8R0.927.158 T	1004
8R0.927.158 T	*	8R0.927.158 T	1006

A6

Old Software part number	Old Software version	New Software part number	New Software version
4G0.927.158 AA	*	4G0.927.158 AA	1004
4G0.927.158 AB	*	4G0.927.158 AB	1004
4G0.927.158 E	*	4G0.927.158 E	1004
4G0.927.158 P	*	4G0.927.158 P	1005

A8

Old Software part number	Old Software version	New Software part number	New Software version
4H1.927.158 AA	*	4H1.927.158 AA	1003
4H1.927.158 A	*	4H1.927.158 A	1007
4H1.927.158 AC	*	4H1.927.158 AC	1004
4H1.927.158 AD	*	4H1.927.158 AD	1007
4H1.927.158 AQ	*	4H1.927.158 AQ	1004
4H1.927.158 AR	*	4H1.927.158 AR	1006
4H1.927.158 B	*	4H1.927.158 B	1008
4H1.927.158 BG	*	4H1.927.158 BG	1006
4H1.927.158 BR	*	4H1.927.158 BR	1007
4H1.927.158 CP	*	4H1.927.158 CP	1008
4H1.927.158 CQ	*	4H1.927.158 CQ	1008
4H1.927.158 CR	*	4H1.927.158 CR	1008
4H1.927.158 M	*	4H1.927.158 M	1007
4H1.927.158 N	*	4H1.927.158 N	1007
4H1.927.158 Q	*	4H1.927.158 Q	1007
4H1.927.158 P	*	4H1.927.158 P	1005

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	3250		
Damage Code:	0010		
Labor Operations:	Software update	0151 0010	See SRT with associated operations
	Software update	0151 0060	Labor according to the diagnostic log
Claim Comment:	As per TSB 2028985/13		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations, as well as any associated tasks.

Additional Information

The software in the gearbox electronics control unit (diagnostic address 0002) must be updated on this vehicle. Explain to the customer that various control units must be reconfigured after the software update to ensure that they function correctly in conjunction with other control units in the vehicle. Components which have been retrofitted in the vehicle but have not been entered in the vehicle equipment list via feedback documentation (version compare) to the SVM may not function correctly after the configuration process. Ask the customer whether they have had non-genuine components retrofitted on the vehicle or modifications carried out by third parties (e.g. tuning) or are aware of any such retrofits or modifications. Inform the customer that, if non-genuine retrofits or modifications have been carried out on the vehicle by third parties, neither Audi of America, LLC/Audi Canada Inc. nor your own company will accept liability for any damage that may be caused by updating the software, or by failing to do so. Make a note to this effect on the job order before it is signed by the customer and put the information in the customer file.

All parts and service references provided in this TSB (**2028985**) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.