



Connection offline

Technical Service Bulletin

Transaction No.: **2082106/2**

37 Gearbox warning lamp on, event memory entry P060A00 (8693) in gearbox control unit - 0BK and 0BL gearbox

Release date: Jun 23, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A8, and S8	2015 – 2017	All	0BK and 0BL Gearbox

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Condition</i> (Corrected typo in model table)
1	06/22/2026	Initial publication

Customer states:

- The gearbox warning lamp in the instrument cluster lights up during vehicle operation.

Workshop findings:

- The customer complaint can be reproduced.
- The following event memory entry (static/intermittent) is logged in the gearbox electronics control unit (diagnostic address 0002):
P060A00: Control module internal processor monitoring
 - Symptom: 8693

Technical Background

Software issue.

Production Solution

Not applicable.

Service

Try to reproduce the customer complaint (according to the customer statement/technical background) so that it can be clearly assigned to this TSB. The following repair must only be carried out if all the criteria (model/type, chassis number, engine/gearbox code, PR number(s), part number, software version, code etc.) apply exactly. Otherwise, this measure will not eliminate the problem, and repeat repairs may be necessary. In such a case, we may reject the warranty claim and charge back the cost of the parts.

If the complaint described in this TSB can be reproduced, update the gearbox software with **SVM code 02A072**.

Old Software part number	Old Software version	New Software part number	Target software version
4H1 927 158 CC	*	4H1 927 158 CC	≥1006
4H1 927 158 CD	*	4H1 927 158 CD	≥1010
4H1 927 158 CE	*	4H1 927 158 CE	≥1005
4H1 927 158 CG	*	4H1 927 158 CG	≥1010
4H1 927 158 CK	*	4H1 927 158 CK	≥1006
4H1 927 158 CT	*	4H1 927 158 CT	≥1010
4H1 927 158 DA	*	4H1 927 158 DA	≥1010
4H1 927 158 DB	*	4H1 927 158 DB	≥1010
4H1 927 158 DC	*	4H1 927 158 DC	≥1010
4H1 927 158 DQ	*	4H1 927 158 DQ	≥1010
4H1 927 158 EH	*	4H1 927 158 EH	≥1010
4H1 927 158 FB	*	4H1 927 158 FB	≥1002
4H1 927 158 FE	*	4H1 927 158 FE	≥1010
4H1 927 158 FF	*	4H1 927 158 FF	≥1006
4H1 927 158 FN	*	4H1 927 158 FN	≥1010
4H1 927 158 FP	*	4H1 927 158 FP	≥1010
4H1 927 158 FR	*	4H1 927 158 FR	≥1010

Warranty

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	3730		
Damage Code:	0041		
Labor Operations:	Software update	0151 0010	See SRT with associated operations
	Software update	0151 0060	Labor according to the diagnostic log

Claim Comment:	As per TSB 2082106/2
-----------------------	----------------------

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

Additional Information

Note:

The **0002 control unit** software needs to be updated on this vehicle. Explain to the customer that various control units must be reconfigured after the software update to ensure that they function correctly in conjunction with other control units in the vehicle. Components which have been retrofitted in the vehicle but have not been entered in the vehicle equipment list via feedback documentation (version compare) to the SVM may not function correctly after the configuration process. Ask the customer whether they have had non-genuine components retrofitted on the vehicle or modifications carried out by third parties (e.g. tuning) or are aware of any such retrofits or modifications. Inform the customer that, if non-genuine retrofits or modifications have been carried out on the vehicle by third parties, neither AUDI AG nor your own company will accept liability for any damage that may be caused by updating the software, or by failing to do so. Make a note to this effect on the job order before it is signed by the customer and put the information in the customer file.

All part and service references provided in this TSB (**2082106**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.