



Connection offline

Vehicle-specific service

Transaction No.: **2082225/1**

24 PSS Engine - calibration of injectors, P268A00, exhaust emissions warning lamp - 4 cyl. 2.0 ltr TFSI

Release date: Jun 10, 2026

Condition


Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment
A5 (FU), Q5, and Q5 Sportback (GU)	2025 – 2026	All	4 cyl. 2.0 ltr. TFSI

Customer states:

- Exhaust emissions warning lamp (MIL) displayed in instrument cluster.

Workshop findings:

- The entry **P268A00** "Fuel Injector Calibration Not Learned/Programmed" (static or intermittent) is logged in the event memory of the engine control unit (diagnostic address 0001).

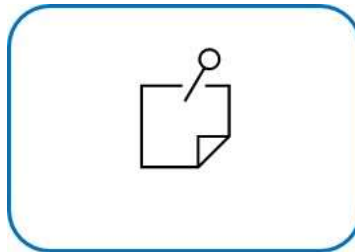

Postpone repair

Technical Background

Software issue in the engine control unit

Production Solution

Not applicable.

Service

Check whether the event memory entry **P268A00** is static or intermittent.

- If the event memory entry is **static**:
 - In this case, please proceed according to Guided Fault Finding. A combined software update is not currently required.
- If the event memory entry is **intermittent**:

Please delete the event memory entry and postpone the repair. A combined software update with the target VR combined software version 03.20.00/C [KD3] is currently being implemented.

It will be rolled out in stages for the different models. All information about the current schedule and availability of the measure can be found in the central service info TSB 2081477, *00 Service info: central overview of combined*

software update 03.11.00/C PPE/PPC – KD2*.

As part of the process, create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in Audi Now; Service | AU-US > Pending Service Solutions (PSS).

Warranty

Claim Type:	• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	GFF	0150 0010	See SRT with associated operations
	GFF	0150 0060	Labor according to the diagnostic log
Claim Comment:	As per TSB 2082225/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Replacing parts or attempting repairs will not resolve this complaint if the event memory entry is intermittent. Unjustified work/replacement parts will be charged back. Invoicing under warranty is not permitted.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

Please bill checking the fuel system according to the time required.

Additional Information

All part and service references provided in this TSB (**2082225**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.