

Vehicle-specific serviceTransaction No.: **2082335/1**24 PSS engine: engine control unit - fuel pressure sensor P01C400 (symptom 46314)
4-cyl. 2.0 ltr. TFSI

Release date: Jun 24, 2026

Condition

Model(s)	Year(s)	VIN Range	Vehicle Specific Equipment			
A5 (FU), Q5, and Q5 Sportback (GU)	2025 – 2026	All	4-cyl, 2.0 ltr. TFSI			
			0001 – Engine electronics			
			Software Part number	Software version	Hardware Part number	Hardware version
			8B3.906.259.B*	0001	*06R*.907.425*	H80
			8B3.906.259.B*	0003	*06R*.907.425*	H80
			8B3.906.259.B*	0002	*06R*.907.425*	H80
			4P5.906.259.C*	0002	*06R*.907.425*	H80
			8MA.906.259.T*	0001	*	*
			4P5.906.259.C	0001	*06R*.907.425*	H80

Customer states:

- The exhaust emissions warning lamp lights up in the instrument cluster.

Workshop findings:

- The following event memory entry is logged in the engine control unit:
 - P01C400** "Fuel Pressure Sensor "A" Circuit Range/Performance" with symptom **46314**.

Technical Background

Software issue in the engine control unit

Production Solution

Not applicable.

Service

Please delete the event memory entry and postpone the repair. A combined software update with the target VR combined software version 03.20.00/C [KD3] is currently being implemented. It will be rolled out in staged for the different models and markets. All information about the current schedule and availability of the measure can be found in the central service info 2081477, *00 Service info: central overview of combined software update 03.11.00/C PPE PPC - KD2**.

As a part of the process, create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in Audi Now; *Service | AU-US > Pending Service Solutions (PSS)*.

Warranty

Replacing parts or attempting repairs will be charged back. Invoicing under warranty is not permitted.

Claim Type:	If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	2409		
Damage Code:	0039		
Labor Operations:	GFF	0150 0010	See SRT with associated operations
	GFF	0150 0060	Labor according to the diagnostic log
Claim Comment:	As per TSB 2082335/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Please note the information on predecessors and items that are included and excluded in the repair operations as well as any associated tasks.

Additional Information

Delete the diagnostic log and continue to observe the vehicle.

All part and service references provided in this TSB (**2082335**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2026 Audi of America, LLC / Audi Canada Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, LLC / Audi Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.