



Service Bulletin

Bulletin No.: PIT6531

Date: June, 2026

PRELIMINARY INFORMATION

Subject: False / Unwanted Front Park Assist Alerts With Nothing In Front Of The Vehicle

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500	2023-2026		All	All	All	All
Chevrolet	Silverado 2500	2024-2026		All	All	All	All
Chevrolet	Silverado 3500	2024-2026		All	All	All	All
GMC	Sierra 1500	2023-2026		All	All	All	All
GMC	Sierra 2500	2024-2026		All	All	All	All
GMC	Sierra 3500	2024-2026		All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	UD5
Condition	Some customers may comment that the front parkassist system issues false alerts on the DIC even when no objects are present in front of the vehicle. There will be no related DTCs.
Cause	Typically, concerns of this nature are caused by the sensors being obstructed by mud, dirt, snow, ice, or slush, or by the conditions outlined in bulletin 22NA068. However, there has been a recent increase in cases traced to aftermarket front LED lighting, including headlights, parking lights, and similar components.

Correction

Before replacing any components or performing indepth diagnostics, inspect the vehicle for aftermarket LED lighting. If any aftermarket LED bulbs are present (headlights, park lights, turn-signal lights, etc.), reinstall the original factory bulbs and reevaluate the system's operation.

Version	1
Modified	06/29/2026 Created on

