



Mitsubishi Motors North America, Inc.

TECHNICAL SERVICE BULLETIN

SUBJECT:

TRANSAXLE REPLACEMENT PROCEDURE UPDATE

No: TSB-26-23-001

Version: 2

Reason for Change: Repair
procedure updated to include
additional PRC information

Date: June 18, 2026

TO: Mitsubishi Motors US and Puerto Rico Dealer Principals, General Managers, Sales Managers, Service Managers, Service Advisors, Parts Managers, Technicians and Warranty Administrators

AFFECTED VEHICLES

MY 2026 Outlander Sport
MY 2026 Eclipse Cross

CUSTOMER COMPLAINT

The message "Transmission Service Required" is displayed in the meter. This condition may be accompanied by one or more of the following symptoms: shift flares, harsh shifting, transmission slipping, and/or reduced forward propulsion. These symptoms may occur at any operating temperature.

CAUSE

The root cause is currently under review and is under joint investigation with MMNA and MMC. Possible Diagnostic Trouble Codes (DTCs) present at time of failure:

- **P084A** Fluid pressure function abnormality
- **P0730** CVT incorrect gear ratio
- **P0969** Primary pressure solenoid valve function abnormality
- **P0776** Abnormality in secondary pressure solenoid valve function
- **P0868** Line pressure low
- **P2719** Select SOL. control/pressure control solenoid (D) circuit range

REMEDY

Vehicles **under** 12 months and 12,000 miles from the in-service date, MMNA will require all information collected: Vehicle Data Collection System (VDCS): ALL_DTC list, Extended FFD_CVT data.

After submission of the required information, Replacement of Transaxle is required.

Note: CVT replacement claims will be subject to debit if all requested information is not submitted.

REPAIR PROCEDURE

- Remove the Automatic Transaxle
- Flush all transmission fluid lines and the fluid cooler
- Install the new Automatic Transaxle
- Perform Continuously Variable Transmission (CVT) initialization per TIN 17-23-001
- Erase/reset oil degradation values
- Update the TCM with the correct calibration for the replacement transmission

Extended FFD must be obtained and uploaded to the PRC system.

The procedure below outlines the steps required to obtain the extended FFD version.

1. Select "CVT" in System Select
2. Select "Data Readout"
3. Click the Screenshot button located at the bottom right of the screen
4. A file name starting with "AD" will be saved on the device
5. Upload this file to PRC

PARTS

Part Name	Part Number	Quantity	Remarks
Auto Transaxle	2700A403	1	

WARRANTY

Labor Operation Code	Operation	Cause Code A	Nature Code B	Nature Code C	Quantity	Labor Time	Primary Failed Part Number
TSB26231	TSB-26-23-001 - T/M REPL under 12/12,000 miles	990	24	E	1	Model/ Spec Code Specific	2700A403

Note: CVT replacement claims will be subject to debit if all requested information is not submitted.

Disclaimer

NOTE: The information contained in this document is intended for use by trained, professional technicians with the knowledge to properly and perform diagnosis and repairs on Mitsubishi vehicles, using Mitsubishi Motors approved tools and equipment. It informs service technicians about conditions that could occur in certain vehicles and provides information that could assist in proper vehicle diagnosis, service, or repair. It does not indicate that a defect is present in any vehicle referenced in this document nor does it imply that the described repairs are covered under warranty. DO NOT assume that a symptom or condition, or a described cause of a symptom or condition, affects any particular vehicle or groups of vehicles, or that a described repair applies to any particular vehicle or groups of vehicles. There can be multiple causes resulting in the same or similar symptoms or conditions described in this document and trained professional service technicians must use their diagnostic skills to make evaluations on a case-by-case basis. The information contained in this document does not guarantee warranty coverage nor does it extend the vehicle's warranty in any way.