



SSM 54978 2024-2026 Nautilus - "Door Fault Service Required", "Transmission Not In Park" And/Or "Hill Start Assist Not Available" Message In The IPC With DTC B1262:92 Stored In Multiple Door Latch Modules

Some 2024-2026 Nautilus vehicles may exhibit a "Door Fault Service Required", "Transmission Not In Park" and/or "Hill Start Assist Not Available" message in the instrument panel cluster (IPC) with diagnostic trouble code (DTC) B1262:92 stored in multiple door latch control modules (DCME, DCMF, DCMG, and/or DCMH). DTC U0504 may also be stored in the gearshift module (GSM). This may be due to the software in the door latch control modules. To correct this condition, download and run the following applications using the latest software level of the Ford Diagnosis and Repair System (FDRS) scan tool.

"DCME - Door Control Module E (DCME) Software Update"

"DCMF - Door Control Module F (DCMF) Software Update"

"DCMG - Door Control Module G (DCMG) Software Update"

"DCMH - Door Control Module H (DCMH) Software Update"

For claiming use causal part 58219A05 and labor operation MTS8219SSM up to 0.5 hours.