



STAR ONLINE PUBLICATION



Case Number: S2608000031

Release Date: July 2026

Models Affected: 2026 Jeep Recon (EJ)

Symptom/Vehicle Issue: The Body Control Module (BCM) Is Actively Setting DTC's When The Doors Are Removed. The Faults Will Go To Stored Once The Doors Are Connected.

Discussion/Diagnosis: The technician may note the following codes:

- U12BC-00 - Lost Communication with Driver Door Latch Module-
- U12BD-00 - Lost Communication with Passenger Door Latch Module-
- U12BE-00 - Lost Communication with Left Rear Door Latch Module-
- U12BF-00 - Lost Communication with Right Rear Door Latch Module-
- U1122-00 - Lost Communication with LIN ECU 2-
- U1123-00 - Lost Communication with LIN ECU 3-
- U0200-00 - Lost Communication with Passenger Door Module-
- U0199-00 - Lost Communication with Driver Door Module-
- U107D-00 - LIN 9 Bus-
- U107E-00 - LIN 10 Bus-

Repair Procedure: If the faults are active with the doors installed. Confirm the door connectors are properly connected, And that no pins are bent or slightly pushed out.

If the faults are stored, then no replacements are required. Please clear the stored DTC's

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.