

Technical Journal

TITLE:

Wind Noise from Side Window

REF NO: TJ 37421.4.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7515 Polestar		ISSUE DATE: 2026-04-24	STATUS DATE: 2026-05-04
FUNC GROUP: 8455	FUNC DESC: Guide moulding for door glass; sealing	Page 1 of 6	

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Attachment

File Name	File Size
TJ37421_1.JPG	2.9108 MB
TJ37421_2.JPG	0.1478 MB
TJ37421_3.jpg	0.0611 MB
TJ37421_4.jpg	0.0638 MB
TJ37421_5.jpg	0.0619 MB

DESCRIPTION:

*Updated attachment TJ37421_3.jpg.

If the customer experiences wind noise coming from the side window, follow advise under “Service”.

CSC Customer Symptom Codes

Code	Description
H6	Doors/Wind noise/Around front side door/window
H7	Doors/Wind noise/Around rear side door/window

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
359							2024-9999		-	202402-999952

Technical Journal 37421.4.0

SERVICE:

*Before replacing any parts, follow the checklist below.

1. Check the calibration of the window. Recalibrate if needed. This can be checked by following reference VCC-524977-1.
2. Inspect the trim moulding (see attachment TJ37421_5.jpg). The pressure from the original window calibration can permanently deform or damage the material, replace needed.

If the checklist above does not resolve the issue, follow steps below.

3. Apply tape to door panel (see attachment TJ37421_1.JPG). Cut the tape to following dimensions: 690 mm long and 25 mm wide, ensuring it covers the entire panel lip.
4. Apply tape to the weatherstrip (see attachment TJ37421_2.JPG and for location, see attachment TJ37421_3.jpg). Cut the tape: 300 mm long and 12.5 mm wide. Apply with 2 layers. The tape should start approximately 300 mm from rear end (B pillar) and only cover the middle portion of the seal, not the entire moulding.

Tape:

Part number: 30788314

Details for cutting (see attachment TJ37421_4.jpg):

- a) Cut 690 mm of the tape.
- b) Cut this piece in half so you have 2 lengths of 690 mm x 25 mm, one tape should be applied for action 3.
- c) Cut the tape to dimension 300 mm long and 25 mm wide.
- d) Then cut the tape in half, so both pieces are 300 mm long and 12.5 mm wide for action 4.

Warranty claim info:

To get a warranty claim accepted for a job described in this TJ, use the corresponding VST OP number stated in this TJ.

Note that the TJ number must be stated in the repair order text.

VST Operation Number

VST Operation Number	Description
85120-2	Panel side door front remove-install
99923-2	General reimbursement acc. to TJ


LABOR TIME:


Labor time subject to change without notice.

VEHICLE REPORT:


Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report Polestar" and sub concern area "Support not needed Polestar", use function group 8455.

To view TJ attachments continue to next page. This TJ has five attachments.

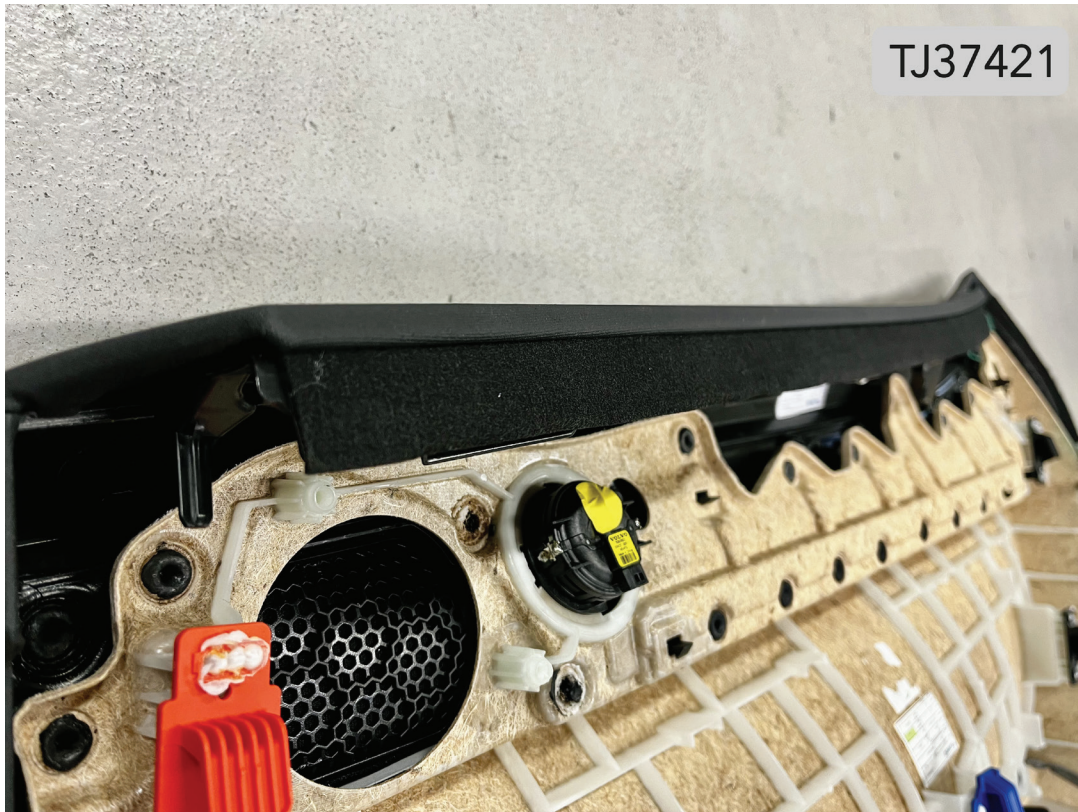


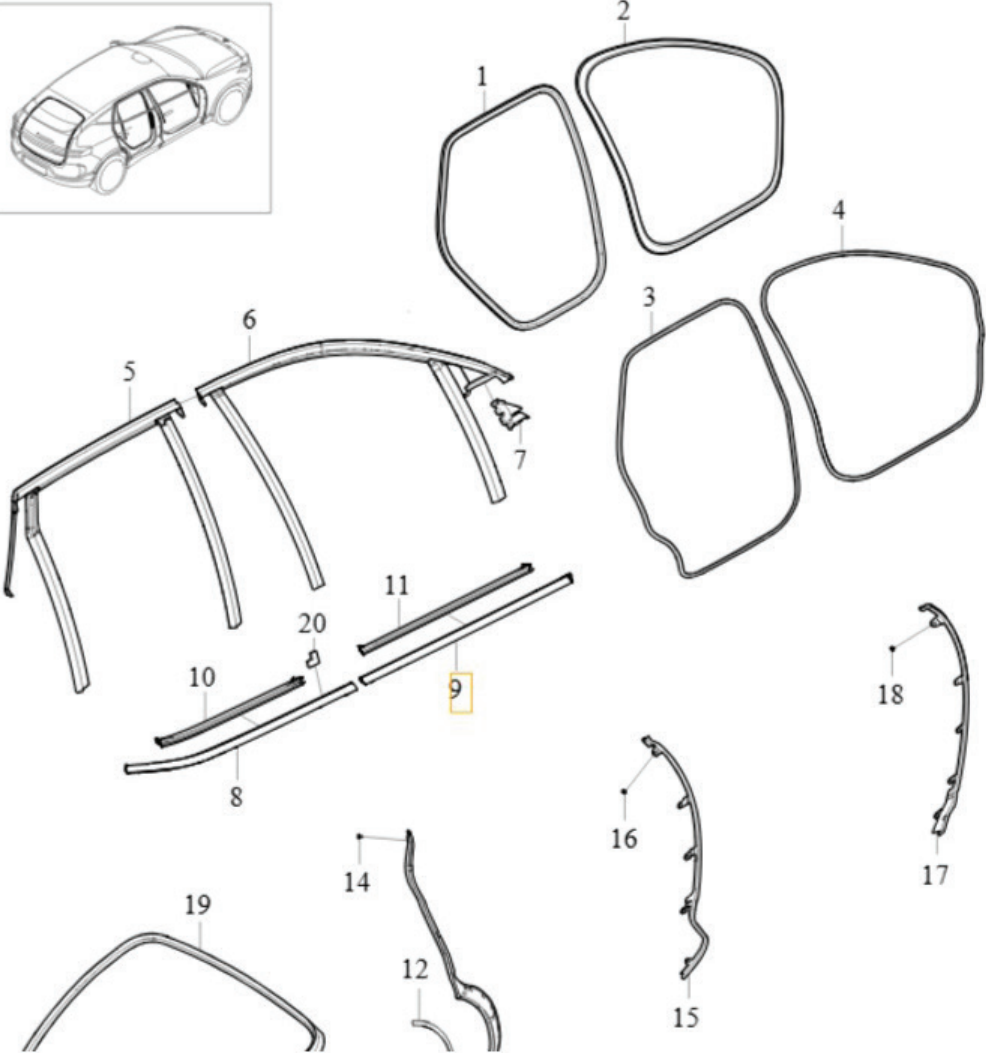

TJ37421_3

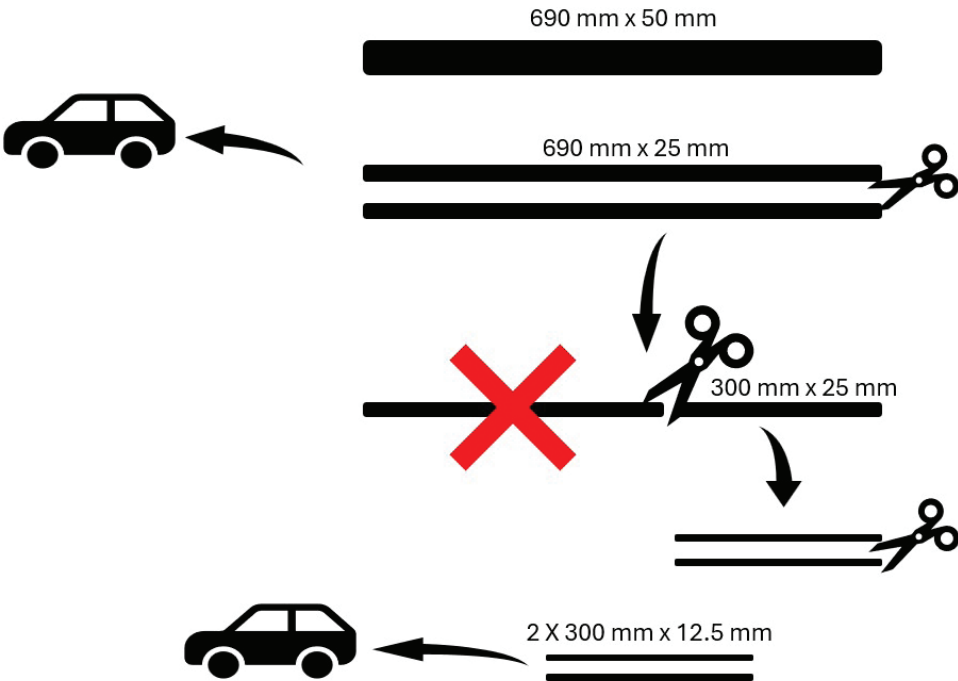

TJ37421

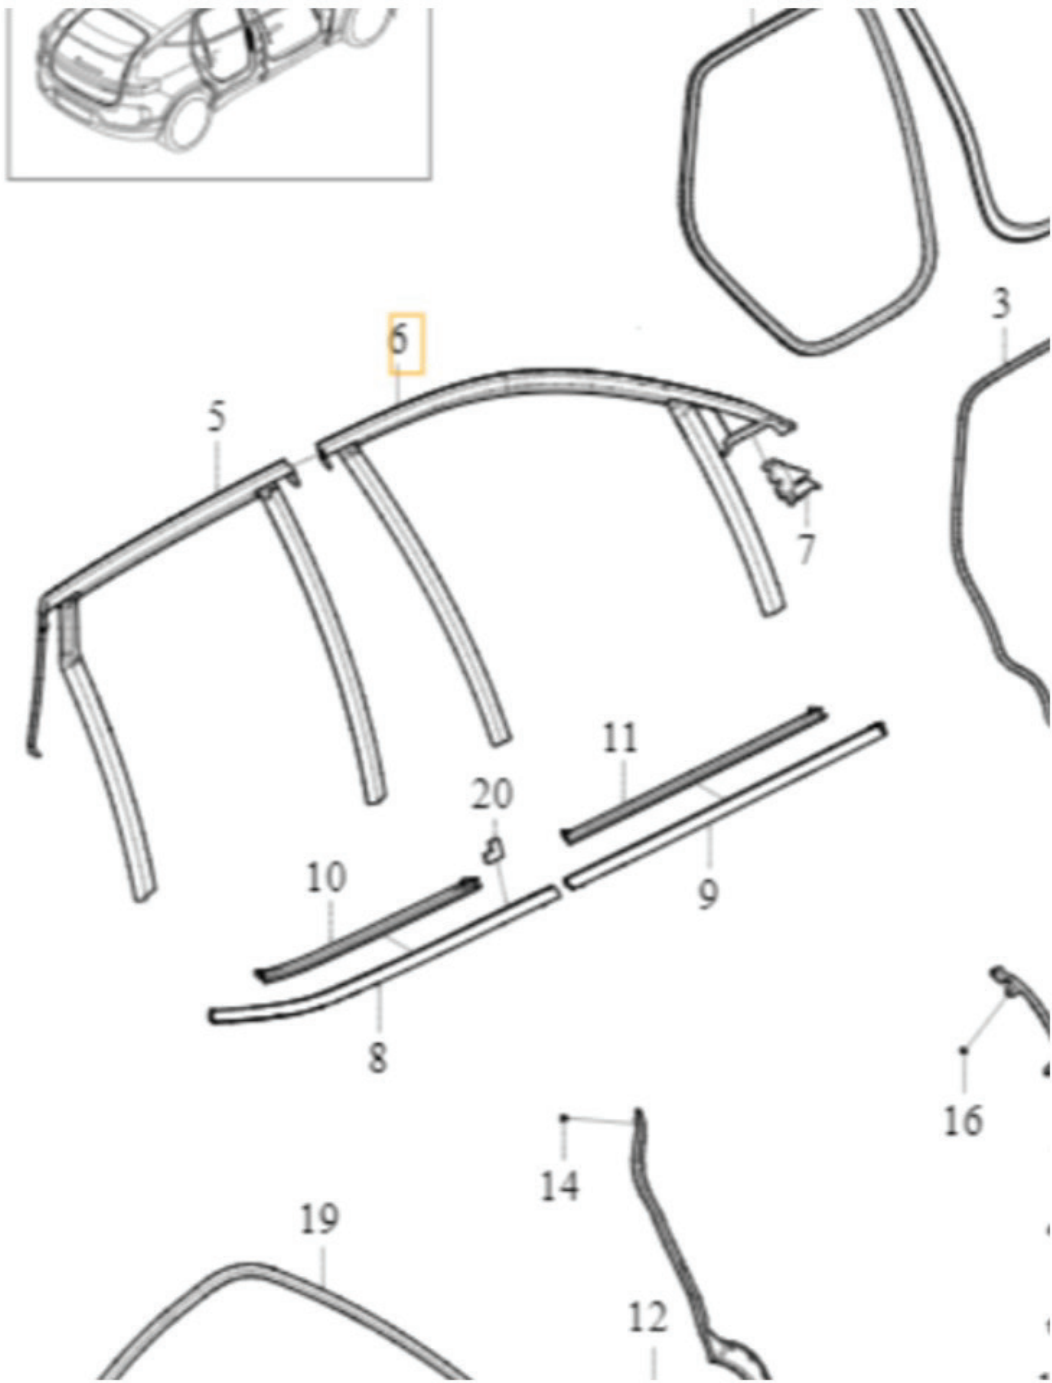

TJ37421