

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 820

Maserati Grecale – Front Fender Trim Paint Check



DATE: July 8, 2026

Certain Maserati vehicles listed in ModisCS+ are involved in a Rapid Update for the inspection and, if necessary, replacement of the front fender arch molding.

VEHICLES INVOLVED: (M182) Grecale MY25-MY26**Required Action**

Perform a visual inspection of the fender arch molding.

On some vehicles, peeling paint may be visible on the end area of the front fender molding. This condition is related to the component production process and appears only as a localized aesthetic concern in a specific area of the molding. This condition does not affect vehicle safety, functionality, or performance; however, it does not meet Maserati quality standards.

We remind you that all Rapid Updates must be performed during the first workshop visit, regardless of the Mandatory setting in Modis, as required by Maserati policies.

For vehicles in dealer stock or undergoing PDI, all required operations must be completed before delivery to the end customer, as required by the White Book and stated in the Pre-Delivery Checklist.

Please read and review this bulletin before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank you for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure




All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.

IMPORTANT: The inspection procedure below is described for one side of the vehicle only. Although the concern is **limited to the left-hand side**, the inspection must be performed on **both sides of the vehicle**.

Note: To facilitate the inspection, rotate the wheel to access the portion of the wheel arch to be checked. Wheel removal is not necessary; the inspection must be performed with the **part correctly installed** on the vehicle.

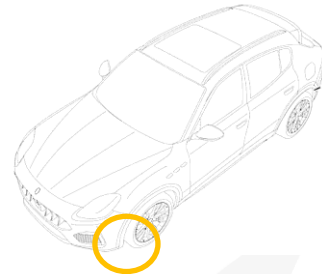

2. Thoroughly clean the affected area of the front fender molding and dry the surface.
3. Use duct tape and place the free end of the tape evenly on the edge of the molding. Make sure the tape adheres properly and that there are **no bubbles or creases by carefully pressing on the contact area**.



4. Remove **the tape** with a **sharp, decisive pull**, maintaining a constant direction.

5. Once the tape has been completely removed, **carefully inspect** both the painted surface and the tape for the presence of:
 - a. Paint peeling off with residue on the tape;
 - b. Paint lifting on the molding;
 Localized peeling in the terminal area of the molding;
 - a. Cracking of the paint.



6. If no obvious or visible **anomalies are present, the vehicle is OK** and no further action is needed.
7. If any of the indicated **defects are noted, the molding is NOK** and must be replaced.
8. Replace **ONLY** the defective component following the instructions in the workshop manual.
 - a. **9.13.094 FRONT RIGHT WHEEL ARCH** Removal/Refitting or Replacement
 - b. **9.13.095 FRONT LEFT WHEEL ARCH** Removal/Refitting or Replacement
9. Reinstall all removed components in the reverse order of removal.
10. The procedure is then complete and the vehicle can be released.

Parts Information

If the inspection fails, replace only the affected component.

Description	Part Number	Quantity
Front Left Fender Molding		
Front wheel arch LH GT/Modena NIGHT IN (Color 080)	670325067	1
Front wheel arch LH GT/Modena ORANGE (Color 583)	670325069	1
Front wheel arch LH GT/Modena COPPER G (Color 915)	670265228	1
Front wheel arch LH GT/Modena VERDE RO (Color 922)	670325066	1
or		
Front Right Fender Molding		
Front wheel arch RH GT/Modena NIGHT IN (Color 080)	670325059	1
Front wheel arch RH GT/Modena ORANGE (Color 583)	670325061	1
Front wheel arch RH GT/Modena COPPER G (Color 915)	670265226	1
Front wheel arch RH GT/Modena VERDE RO (Color 922)	670325058	1

Warranty Claim Information

Please complete the warranty request as follows:

Description	Code
Rapid Update Number	820
Warranty code	23
Error code	063
Component Code	9.13.095
Operation Code ▪ Check (2 sides) ▪ Replacement 1 side	9.13.095.A (0,10 h) 9.13.095.B (0,15 h)