

Technical Service Bulletin (TSB)
Power Folding Seat Wire Harness Pinched

REFERENCE:	TSB: 08-274-26 GROUP: 08 - Electrical	Date:	July 11, 2026	REVISION:	—
VEHICLES AFFECTED:	2021 - 2025 (WL) Jeep Grand Cherokee/ Grand Cherokee L This bulletin applies to equipped with 3rd Row 50/50 Power Fold Seat (Sales Code CBB) and one of the following: 3.6L V6 24V VVT Engine Upg I w/ESS (Sales Code ERC). 5.7L V8 Hemi MDS Engine VVT (Sales Code EZH).			MARKET APPLICABILITY: ☒ NA☒ MEA ☒ SA☒ IAP ☒ EE☐ CH NOTE: This bulletin applies to North and South America, Enlarged Europe, Middle East & Africa, and India & Asia Pacific markets.	
CUSTOMER SYMPTOM:	Customers may experience one or more of the following: - Battery is depleted. NOTE: Battery depletion may be due to a pinched power folding seat wire harness behind the left quarter panel by the cargo tie down fastener. - Loss of function of the rear folding seats. - Rear folding seat behavior is not functioning as expected.				
CAUSE:	Pinched power folding seat wire harness				

REPAIR SUMMARY:

This bulletin involves repairing a pinched power folding seat wire harness behind the left quarter panel.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-52-29-90	Harness, Folding Seat Module - Repair (2 - Skilled)	6 - Electrical and Body Systems	0.6 Hrs.
Failure Code	ZZ	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	04778570	Tube, Heat Shrink	

DIAGNOSIS:


If the customer describes any of the symptoms listed above in the customer symptom section, perform the Repair Procedure.

REPAIR PROCEDURE:

1. Remove the cargo tie down from the left quarter panel to expose the power folding seat wire harness [Fig. 1](#).

**Fig. 1**

2. Inspect the power folding seat wire harness for damaged or pinched wires [Fig. 2](#).

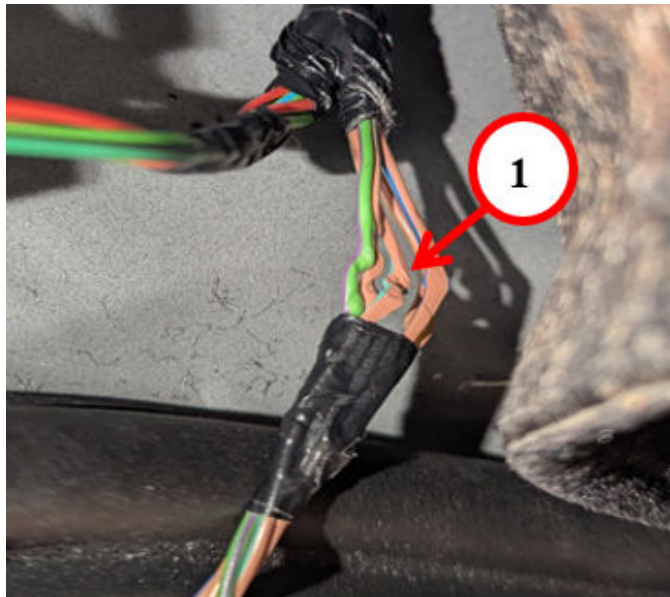**Fig. 2**

Inspect Power Folding Seat Wire Harness

1 - Compromised Power Folding Seat Wire Harness

3. Is the power folding seat wire harness pinched or damaged?
 - YES>>> Proceed to [Step 4](#).
 - NO>>> This bulletin does not apply. Proceed to [Step 11](#).
4. Remove the cargo load floor. Refer to the detailed service procedures available in DealerCONNECT/ Service Library under: Service Info> 23 - Body / Interior / Load Floor, Cargo / Removal and Installation.

5. Gently pull the left quarter trim panel bottom out to gain access to and disconnect the power folding seat wire harness connectors [Fig. 3](#).

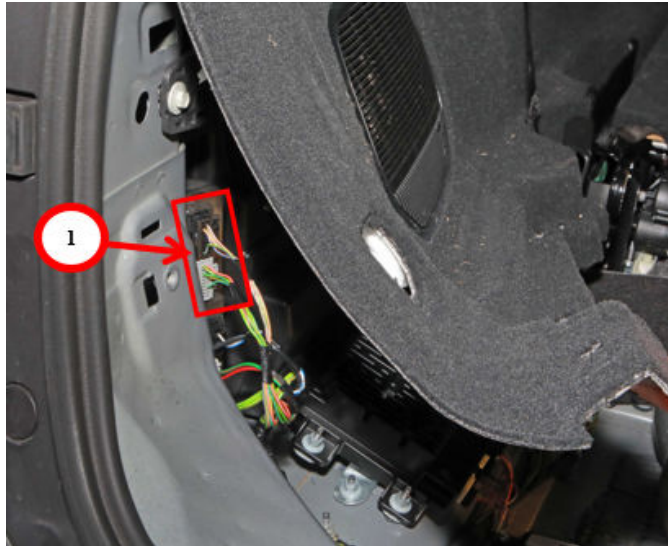


Fig. 3

Power Folding Seat Wire Harness Connectors Locations

1 - Power Folding Seat Wire Harness Connectors behind the left quarter panel.

6. Gently pull the power folding seat wire harnesses underneath the left quarter panel [Fig. 4](#).

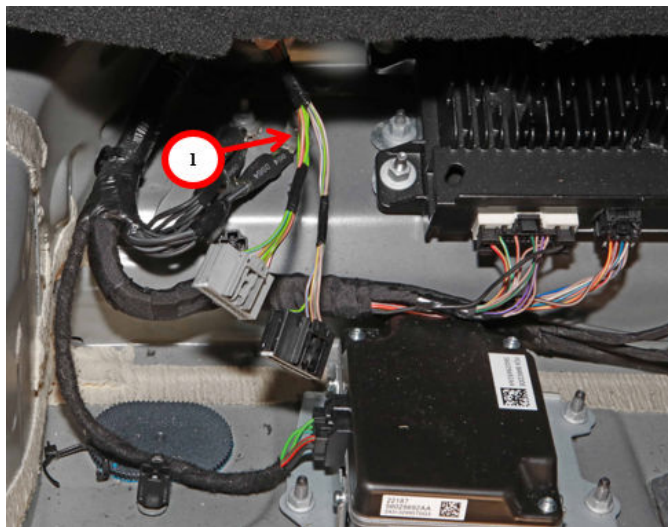


Fig. 4

Power Folding Seat Wire Harness

1 - Accessing Power Folding Seat Wire Harness

7. Repair the pinched power folding seat wire harness. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 29 - Non-DTC Diagnostics / Circuit Testing Procedures / Standard Procedure
8. Route the power folding seat wire harnesses underneath the left quarter panel.
9. Connect the power folding seat wire harness connectors.
10. Install the cargo load floor. Refer to the detailed service procedures available in DealerCONNECT/Service Library under: Service Info> 23 - Body / Interior / Load Floor, Cargo / Removal and Installation.
11. Install the cargo tie down to the left quarter panel.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.