

Technical Service Bulletin (TSB)
Seed Request Denied During
Powertrain Control Module (PCM) Reprogramming

REFERENCE:	TSB: 18-066-26 GROUP: 18 - Vehicle Performance	Date:	July 8, 2026	REVISION:	—
VEHICLES AFFECTED:	2025 (DJ) RAM 2500 Pickup 2025 (D2) RAM 3500 Pickup 2025 (DP) RAM 4500/5500 Cab Chassis 2025 (DD) RAM 3500 Cab Chassis This bulletin applies to vehicles equipped with a 6.4L V8 Hemi HD Engine (Sales Code ESL).			MARKET APPLICABILITY: ☒ NA☐ MEA ☐ SA☐ IAP ☐ EE☐ CH NOTE: This bulletin applies to North America markets.	
CUSTOMER SYMPTOM:	Technicians may experience the following: The scan tool displays the message "Seed Request denied" when attempting to reprogram the PCM to the latest available software.				
CAUSE:	PCM Software				

DISCUSSION:

This Information Only bulletin provides guidance for a reported condition when attempting to reprogram the PCM to the latest software level. Technicians are presented with a wiTECH message of "Seed Request Denied" and the software reprogramming is unsuccessful. When experiencing this condition, verify that the latest wiTECH software is being used and that the battery voltage is being maintained within specification throughout the reprogramming event. Attempt the flash reprogramming procedure one additional time after correcting any power or communication concerns. If the flash reprogramming continues to fail, **do not replace modules solely due to this condition**. Open a STAR case and provide the complete flash logs and the vehicle scan data. Engineering is investigating the root cause.

POLICY:

Information Only.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.