

MODEL: MY2025 Revero, MY2020 Revero GT & GTS, MY2021 and MY2022 GS-6

TITLE: Vehicle Recovery Cap Retention Remedy

Type: Technical Service Bulletin

Year: 2026

System: (70) Body

Sequence: 01

PURPOSE: A service procedure to remedy a loose recovery cap on the front fascia, and to secure any new cap when reinstalled

On inspection Karma built vehicle this communication will provide a solution to increase the fastening tension of the vehicle recovery cap. The cap may be missing or have been previously replaced. If the cap is still secured remove it as instructed in this bulletin.


Should the vehicle be presented without a cap inspect the Front fascia from the underside, as the cap may have fallen into the area. When retrieved, follow the directions below to secure the part. If the part is not found, order part C131172800302 as needed from Karma Automotive.

Place a temporary piece of tape as an anchor on the cap as shown in (Fig 1).

Apply pressure to the bottom portion of the cap to pop it out (Fig 2).

As the cap rotates (Fig 3) use the tape to assist in guiding the cap out to remove safely from the front fascia the remove the recovery cap.

Set the cap on a clean surface and remove the anchoring tape.

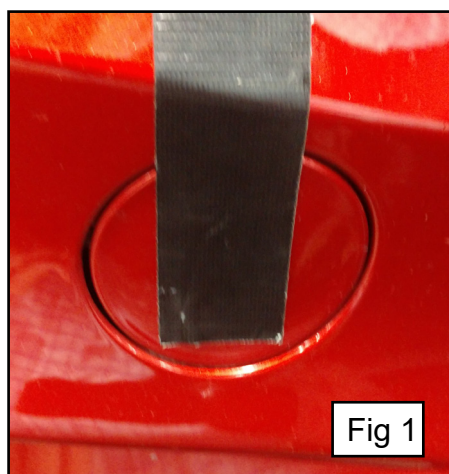

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to an Authorized Karma Service Provider or qualified service center. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Service Provider that the bulletin you intend to use contains the latest available information.

MODEL: MY2025 Revero, MY2020 Revero GT & GTS, MY2021 and MY2022 GS-6

TITLE: Vehicle Recovery Cap Retention Remedy

Type: Technical Service Bulletin

Year: 2026

System: (70) Body

Sequence: 01

Use a felt tape for the following procedure.

Source this locally, felt wire loom tape if none is available. This is available on-line and at most auto parts stores (Fig 4a and Fig 4b).



Fig 4a

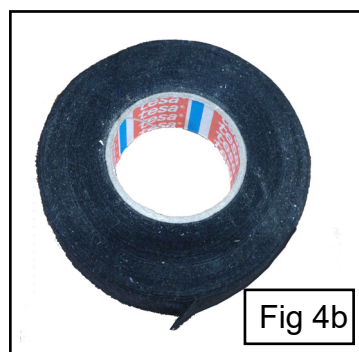


Fig 4b

The existing or new cover (fig 5a and fig 5b) will now have the tabs wrapped with the felt tape.

Cut small strips to wrap these tabs neatly providing one or two layers of the tape on each tab (fig 6a and fig 6b). This should not be too thick so as to cause too great an effort on installation. Installation is the reverse of removal.

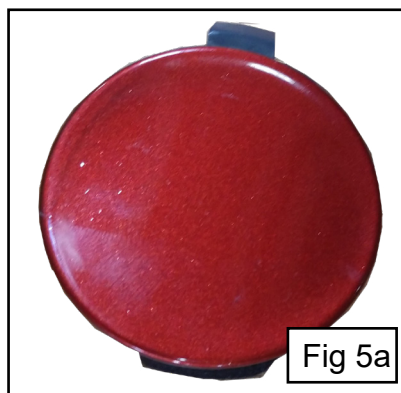


Fig 5a



Fig 5b

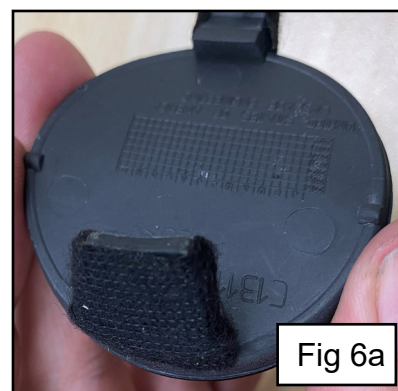


Fig 6a

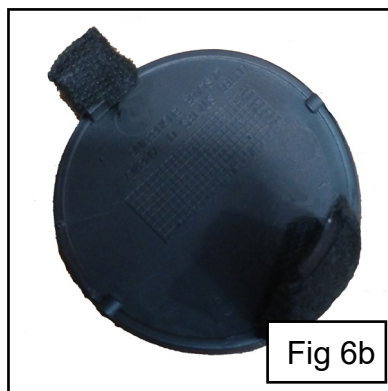


Fig 6b

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to an Authorized Karma Service Provider or qualified service center. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Service Provider that the bulletin you intend to use contains the latest available information.

MODEL: MY2025 Revero, MY2020 Revero GT & GTS, MY2021 and MY2022 GS-6

TITLE: Vehicle Recovery Cap Retention Remedy

Type: Technical Service Bulletin

Year: 2026

System: (70) Body

Sequence: 01

PARTS REQUIRED:

PART NUMBER	DESCRIPTION	QTY
N/A	N/A	N/A

SHOP SUPPLIES:

DESCRIPTION
Source locally: wire loom harness tape (recommended Tesa)

SPECIAL TOOLS and PARTS:

PART NUMBER	DESCRIPTION	QTY
N/A		

LABOR CODES:

CODE	DESCRIPTION	TIME	DEFECT CODE
70-20-21-03	Recovery Cap Reinstall with Support	0.3	70-20-21-11

SUBLET: (if paint is required for a new recovery cap)

CODE	DESCRIPTION	AMOUNT
PAI	Paint	N/A

CAUSAL PART:

PART NUMBER	DESCRIPTION
C131172800302	Cap - Vehicle Recovery

WARRANTY DISPOSITION:

Karma Automotive Bulletins and service documents are intended for use by experienced and trained Technicians. If you lack the skills, tools, equipment and a suitable workshop for any procedure described in this document, we suggest you leave such repairs to an Authorized Karma Service Provider or qualified service center. See your service provider for advice on whether your vehicle may benefit from the information contained within this document. The information contained in the Karma Bulletin is accurate at the date of publication. However, Karma Automotive regularly updates technical information. Please check with your Karma Automotive Service Provider that the bulletin you intend to use contains the latest available information.