

Technical product information

Topic	HVAC failing to cool DTC B16A1F0 in diagnostic address 00C5 Bentayga Series (Hybrid)
Market area	Australia E04 Bentley rest Asia and Australia (6E04),China 723 Volkswagen (Anhui) Automotive CO (6723),China 796 VW Import Comp. Ltd (Vico), Beijing (6796),Germany E02 Bentley rest Europe (6E02),Japan E03 Bentley Japan (6E03),Korea, (South) E08 Bentley South Korea (6E08),United Arab Emirates E06 Bentley Middle East and Africa (6E06),United Kingdom E01 Bentley UK (6E01),United States E05 Bentley USA and rest America (6E05)
Brand	Bentley
Transaction No.	2071190/4
Level	EH
Status	
Release date	16 Jul 2026

Event memory entries

Diagnostic address	Event memory entry	Fault type	Fault status
00C5 - Thermal management	B16A1F0: Refrigerant shut-off valve Icing - water load too high		static
00C5 - Thermal management	B16A1F0: Refrigerant shut-off valve Icing - water load too high		Intermittent

New customer code

Object of complaint	Complaint type	Position
air conditioning -> heating, cooling -> A/C unit cooling capacity -> A /C compressor control	functionality -> without function / defect	

Vehicle data

Bentayga - Hybrid

Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
4V14F9	2019	E		*	*	*
4V14F9	2020	E		*	*	*
4V14F9	2021	E		*	*	*

4V14F9	2022	E		*	*	*
4V14F9	2023	E		*	*	*
4V14F9	2024	E		*	*	*
4V14F9	2025	E		*	*	*
4V14F9	2026	E		*	*	*
4V14F9	2027	E		*	*	*
4V15F9	2025	E		*	*	*
4V15F9	2026	E		*	*	*

Documents

Document name
master.xml



Connection offline

Technical product information

Transaction No.:

2071190/4

HVAC failing to cool | DTC B16A1F0 in diagnostic address 00C5 | Bentayga

Series (Hybrid)

Release date: 16 Jul 2026

Customer statement / workshop findings

Customer statement

HVAC system is not cooling

Workshop findings

DTC B16A1F0 - Refrigerant shut-off valve icing - water load too high, evident within diagnostic address 00C5

Technical background

Upon receipt of a customer complaint relating to HVAC system not cooling and DTC B16A1F0 is evident, please refer to the Measure section of this TPI

Production change

The procedure within the manufacturing process has been reviewed and changed as part of the Bentley Motors continuous improvement policy

Measure



WARNING

This vehicle uses a High voltage system and **MUST** only be worked on by suitably qualified personnel



CAUTION

Please ensure all guidelines within the repair manual are strictly followed before and whilst conducting any work on vehicles with a High voltage system

- 1) Referring to Rep.Gr 44 - Remove the left hand front wheel
- 2) Referring to Rep.Gr 66 - Remove the left hand front foremost wheel arch liner
- 3) Remove (x3) speaker box fixings (5Nm)
 - Disconnect the speaker box electrical connector
 - Remove the speaker box
- 4) Access can now be gained to the required connector plugs - Figure 1 shows G826 and G395 with the connector plugs fitted incorrectly
 - Low pressure sender G826 connector plug with 4 wires **(Incorrect)**
 - High pressure sender G395 connector plug with 3 wires **(Incorrect)**

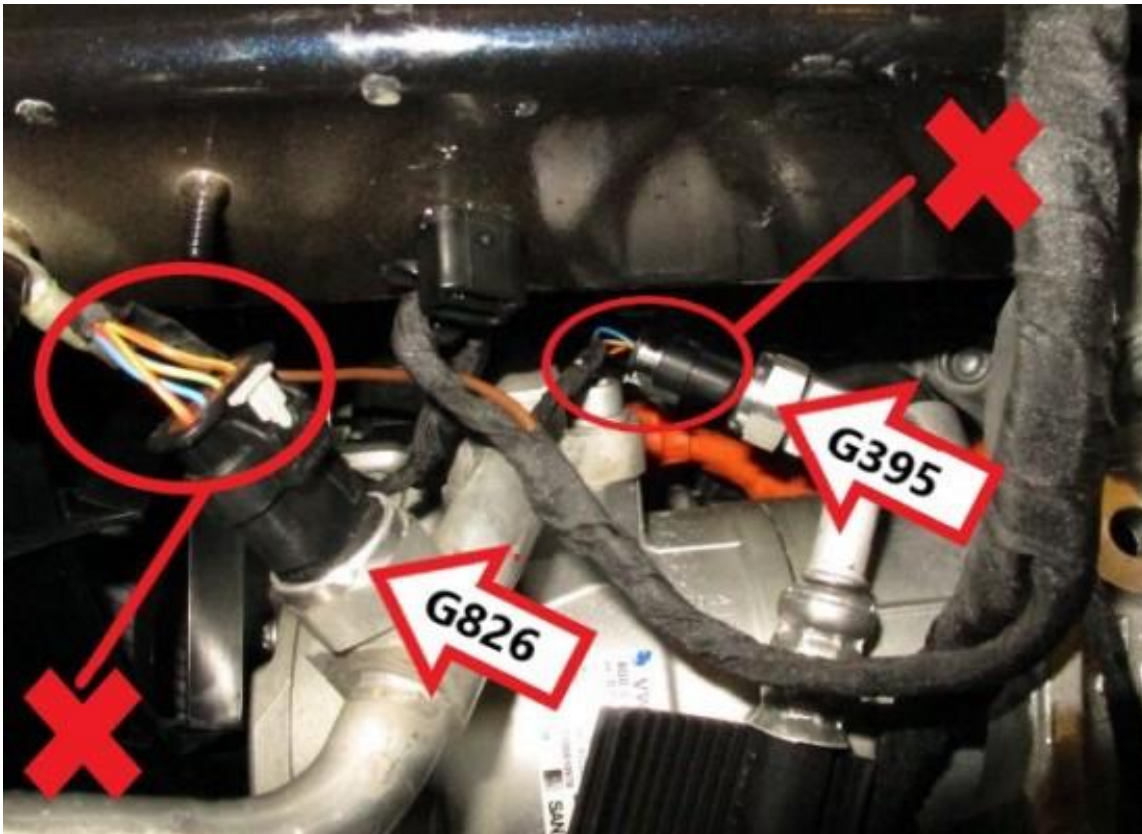


Figure 1



NOTICE

In the event the pressure sender connector plugs are fitted incorrectly the plugs should be disconnected and refitted correctly as shown in Figures 2 and 3

- Figure 2 shows G826 and G395 connector plugs fitted correctly
- Low pressure sender G826 connector plug with 3 wires **(Correct)**
- High pressure sender G395 connector plug with 4 wires **(Correct)**

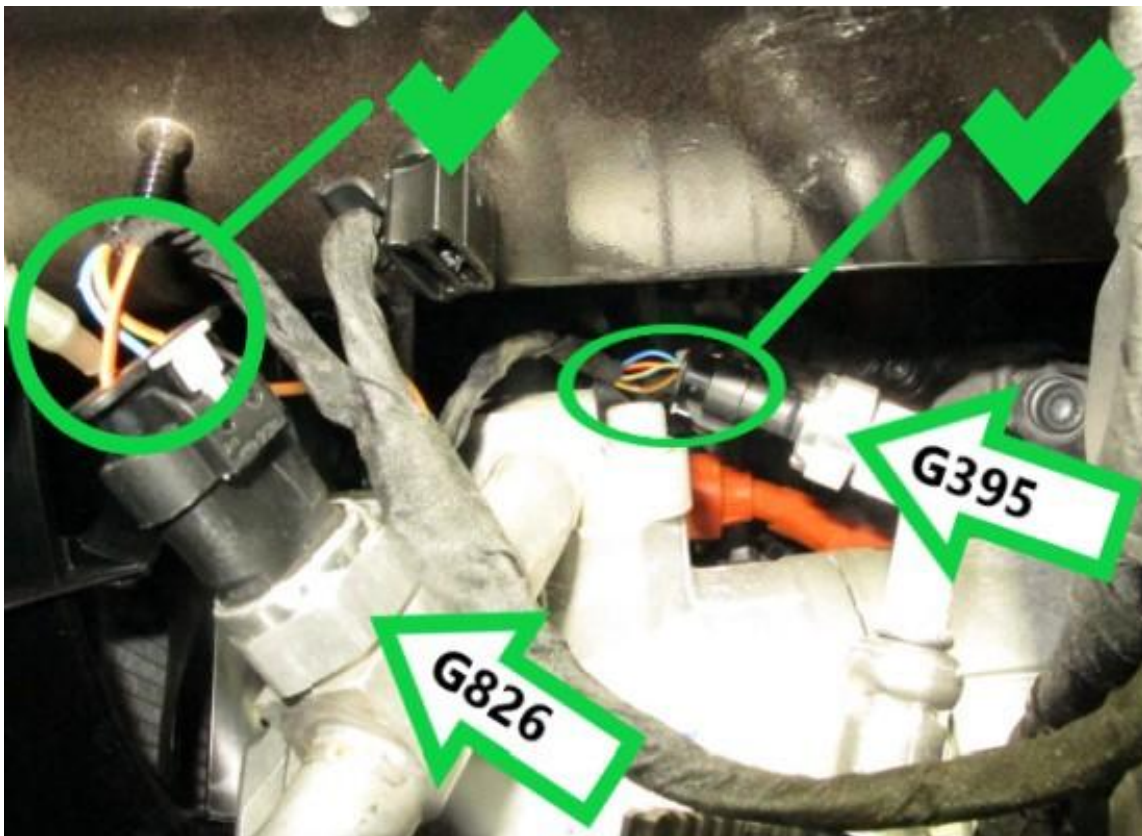


Figure 2

Hint: Figure 3 shows G826 and G395 as per the applicable Current Flow Diagram (Correct)

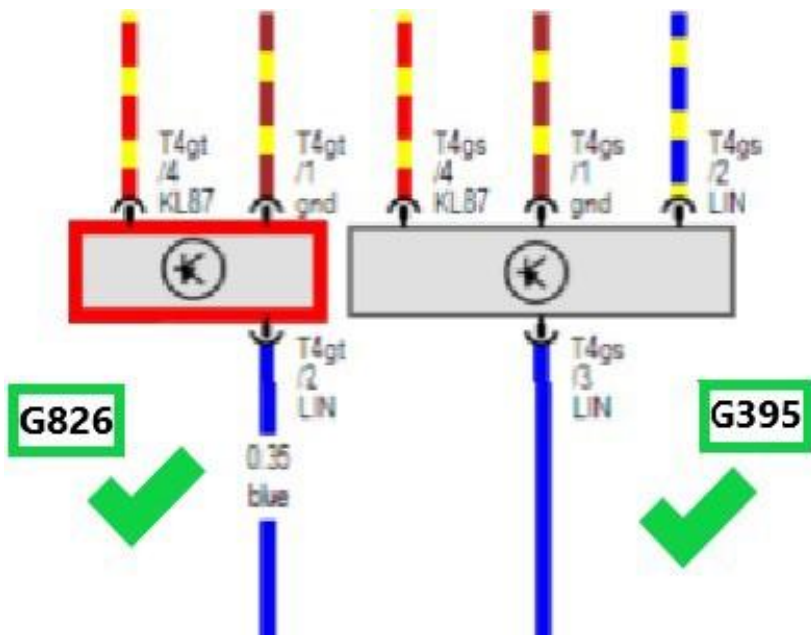


Figure 3

- 5) Once the orientation of the connector plugs is correct - Refit all previously components
- 6) Check the HVAC system is operating to specification

NOTICE

Road test must not be conducted, the HVAC operation can be checked statically without conducting a road test

Warranty accounting instructions

Warranty type - 110 or 910

Damage Service Number 97 97

Damage Code 00 12

Labour

ODIS diagnostic time

Labour Operation Code 01 50 00 00

Time As per ODIS log (Must not exceed 10 TU)

Time to disconnect and reconnect (x2 plugs) G826 and G395 to correct orientation

Labour Operation Code 87 09 01 00 (Use 99 index until 14/09/23)

Time 80TU



NOTICE

Road test must not be conducted, the HVAC operation can be checked statically without conducting a road test, any warranty claims which include a road test will be cancelled