



Connection offline

Technical Service Bulletin

Transaction No.: 2082802

/1

91-26-05 - Driver Assist Systems Restricted Availability/Messages/Event Entry
U112200

Condition

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans Code	VIN Range From	VIN Range To
GTI	2026-2027	All	All	All	All
Golf R	2026-2027	All	All	All	All
Tiguan	2025-2027	All	All	All	All

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2082802/1	7/21/26	91-26-05	Original Publication

Customer Statement:

- The Driver Assist system (various) have restricted availability/are not available

And/or

- One or several of the following messages is/are shown in the Instrument Cluster/radio-navigation system display:
 - Front Assist limited availability.
 - Traffic Sign detection restricted.
 - Travel Assist not available.

Workshop findings

- The customer statement cannot be reproduced.

In the adaptive cruise control unit (address code 0013) the following event entries are (sporadically) logged:

- U112200:data bus implausible message / Symptom: 1842

And

- U112200:data bus implausible message / Symptom: 1884

And

- U112200:data bus implausible message / Symptom: 1885

Technical Background

The sporadic event entries “U112200 data bus, implausible message (with symptom 1842, 1884 and 1885) ” under diagnostic address (0013_ indicates that the view of the front camera for driver assist systems diagnostic address (00A5) is/was temporarily restricted.

If the view is temporarily restricted (for example, due to steamed-up windshield, poor weather/lighting conditions), the functions of certain assist systems are temporarily restricted/switched off.

A shutdown due to the reasons above is technically unavoidable. However, it does not represent a malfunction of the system application. A shutdown is also not a fault in the sense of warranty.

It must be ensured that the field of vision of the front camera/front sensors are neither very dirty/physically steamed-up nor adversely affected by poor weather conditions



NOTICE

Even after operation of the auxiliary heater there is a possibility that the windshield in the area of the front camera for driver assist systems (-R242-) may still briefly steamed-up. This is physically related and not a malfunction.

- As soon as the front camera/front sensors is/are working again, the assistance systems are also fully available again.

Production Solution

N/A.

Service



NOTICE

Explain the above Technical Background to the customer.

Warranty

N/A.

Required Parts and Tools

No Special Parts required.

No Special Tools required.

Additional Information

All parts and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2026 Volkswagen Group of America, Inc. / Volkswagen Group Canada Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc. / Volkswagen Group Canada Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.