

Complaint - Battery Low and Yellow Warning Message "Battery low _ Service necessary" in Instrument Cluster: Re-Programming Gateway Control Unit (Battery Sensor) (168/18)

Change
Overview:

Revision	Date	Change
0	02/07/2019	▪ First Publication
1	01/26/2024	▪ Update to Information
2	07/22/2026	▪ Addition of Equipment ▪ Update to Cause ▪ Update to Work Procedure

Model Year: **As of 2018 up to 2019**

Model Line: **Cayenne (9YA)**

Subject: **Battery Sensor**

Equipment: 12-volt vehicle electrical system battery from **manufacturer LG**



Information

The Technical Information (TI) is only valid for vehicles with a **12-volt vehicle electrical system battery from LG**.

This TI cannot be used on vehicles with another vehicle electrical system battery, e.g. A123.

Information:




Information

In the event of a customer complaint about a **flat battery** and if the yellow warning message "**Battery low _ Service necessary**" (⇒ *Yellow warning message: Battery low _ Service necessary*) appears in the instrument cluster, the following points must be observed before doing any other work:

- A chain of different factors can cause an increased closed-circuit current (greater than 1.0 A) after charging.
- A **battery sensor software version lower than "1000"** can bring about this symptom.
- In the event of a customer complaint and if the **battery sensor software version in the gateway control unit is lower than "1000"**, **re-program** the **battery sensor** as described in the "Procedure" section.

Replacing components will **not** resolve the problem.

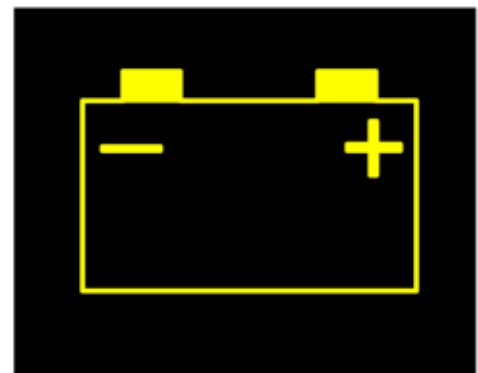

Yellow warning message: Battery low _ Service necessary

Date of Introduction: A control unit with adapted software has been used during production since April 12, 2018 or as of chassis number 9Y 2KD A9 5209.

Tools:

- **P90999 - Porsche Tester 4** with software **version 44.200.010** (or higher) installed
- **Battery charger** with a current rating of **at least 90 A**.

Work
Procedure:

NOTICE**Voltage drop**

- **Irreparable damage to control unit**
 - **Damage to control unit**
 - **Fault entries in the control unit**
 - **Control unit programming/coding is aborted**
 - **Malfunctions in the control unit, even during programming/coding**
- ⇒ **Switch off ignition before disconnecting the control unit.**
- ⇒ **Make sure that the power supply is not interrupted during programming/coding.**
- ⇒ **Connect the battery charger with at least current 90 A to the vehicle battery.**

1

Preliminary work:

- 1.1 Connect a battery charger with a current rating of **at least 90 A**.
- 1.2 Switch on the ignition.

NOTICE

Coding will be aborted if the WiFi connection is unstable.

- **An unstable WiFi connection can interrupt communication between PIWIS Tester 4 and the vehicle communication module (VCI). As a result, coding/programming may be aborted.**
- ⇒ **During control unit coding/programming, always connect the Porsche Tester to the vehicle communication module (VCI) via the USB cable.**

- 1.3 **P90999 - Porsche Tester 4** with software version **44.200.010** (or higher) installed must be connected to the vehicle communication module (VCI) via the **USB cable**. Then, connect the communication module to the vehicle and switch on the PIWIS Tester.
- 1.4 On the PIWIS Tester start screen, call up the ⇒ **'Diagnostics'** menu.
The diagnostic application is then started and the control unit selection screen is populated.

2 Re-program battery sensor:



Information

The procedure described here is based on the **P90999 - Porsche Tester 4** test software version **44.200.010**.

The PIWIS Tester instructions take precedence and in the event of a discrepancy, these are the instructions that must be followed.

A discrepancy may arise with later software versions for example.

Menu		⇒	Control unit/Function	⇒	Action	⇒	confirm/execute
▪ Instructions/information or				▪ ⇒	Result/consequence of action		
2.1	Control units 'Overview'		'Additional menu'		call up		[F7]
2.2	⇒ Follow instructions:						[Yes] / [No] / [F12]
	▪ Create Vehicle Analysis Log (VAL) if necessary and						
	▪ carry out any campaigns that are available for the vehicle.						
2.3			'Campaign'		select		[F12]
2.4	Campaign number		Value: 'E3B4T'		enter		[F12]
Read and follow the information and instructions on the PIWIS Tester during the guided programming sequence. Then press [>>] to continue. During the programming sequence, the control unit is re-programmed and then re-coded automatically if necessary. Do not interrupt programming and coding. Once control unit programming - and coding if necessary - is complete, you will be prompted to switch the ignition off and then back on again after a specified waiting time.							
2.5	Control units 'Overview'		Gateway		select		
2.6	'Extended identifications'				select		
Battery sensor software version programmed during this campaign					2000		
If programming is not completed successfully (error message "Programming unsuccessful"), programming must be repeated .							

3 Subsequent work:

- 3.1 Read out and erase all fault memories.

**Information**

If there are still fault memory entries in individual control units, start the engine briefly and then switch it off again. Wait for approx. 10 seconds before switching the ignition on again and re-establish the connection between the PIWIS Tester and the vehicle. Then read out and erase the fault memories of the affected control units again separately.

- 3.2 Switch off ignition.

- 3.3 Disconnect the PIWIS Tester from the vehicle.

- 3.4 Calibrate the battery by charging it fully.

⇒ Workshop Manual '2X00IN Trickle charging 12-volt lithium-ion battery'

- 3.5 Switch off and disconnect the battery charger.

End of action required.

Labor Position: The work involved is invoiced under the labor operation:

APOS	Labor operation	I No.
90352500	Programming gateway control unit	

For invoicing and documentation using PQIS, enter the following coding:

Location (FES5)	27060	Vehicle electrical system battery
Damage type (SA4)	1611	does not function

References: ⇒ Technical Information '944900 Complaint - Battery flat and specific fault code in front-end electronics control unit: Observe specified procedure [154/18]'

⇒ Workshop Manual '2X00IN Trickle charging 12-volt lithium-ion battery'

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2026 Porsche Cars North America, Inc.