



Technical Service Bulletin

Technical Service Bulletin: TSB260113

Released Date: 27-Jul-2026

SPN|FMI 190|0 Logging at Start-Up

SPN|FMI 190|0 Logging at Start-Up

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected:

- B6.70 CM3580 B193B

Issue Summary

Symptom:

- The following SPN|FMI is present at vehicle start up:
 - 190|0

Root Cause:

- Engine Control Module (ECM) calibration tuning

Verification

- Verify SPN|FMI 190|0 is logging during start-up.
- Verify observed engine idle speed remains below 2000 RPM.
- Check if any other fault codes are logging or any other symptoms are present.

Resolution

If any other SPN|FMI(s), besides 190|0, are actively logging, or if there are any other symptom(s) present, troubleshoot those other SPN|FMI(s)/symptom(s) first.

If the **only** SPN|FMI logging is 190|0 and there are no other SPN|FMI or symptom present, no further troubleshooting or part replacements are required.

- There is a pending ECM calibration release to address 190|0 occurrences.

The ECM calibration release to fix this issue is scheduled to occur in late 2026.

Document History

Date	Details
2026-7-24	Module Created

Last Modified: 27-Jul-2026
