

## Technical Service Bulletin (TSB)

### Potential Engine Oil Overfill

|                    |                                                                                                                                                                                                      |       |                |                                                                                                                                                                                                                                                                                        |   |
|--------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------|----------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---|
| REFERENCE:         | TSB: 09-019-26<br>GROUP: 09 - Engine                                                                                                                                                                 | Date: | August 8, 2026 | REVISION:                                                                                                                                                                                                                                                                              | — |
| VEHICLES AFFECTED: | 2026 (WL) Jeep Grand Cherokee / Grand Cherokee L<br>This bulletin applies to vehicles built on or before July 30, 2026 (MDH 0730XX) equipped with the 2.0L Hurricane 4 Turbo W/ESS (Sales Code EC7). |       |                | MARKET APPLICABILITY:<br><div><input checked="" type="checkbox"/> NA<input type="checkbox"/> MEA<br/><input type="checkbox"/> EE<input type="checkbox"/> IAP<br/><input type="checkbox"/> SA<input type="checkbox"/> CH</div><br>NOTE: This bulletin applies to North America markets. |   |
| CUSTOMER SYMPTOM:  | Customers may comment on the following: <ul style="list-style-type: none"><li>Misfires or sluggish engine performance.</li></ul>                                                                     |       |                |                                                                                                                                                                                                                                                                                        |   |
| CAUSE:             | Engine oil may have been overfilled                                                                                                                                                                  |       |                |                                                                                                                                                                                                                                                                                        |   |

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 26-152, date of issue August 08, 2026. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty.

#### REPAIR SUMMARY:

This bulletin involves inspecting the engine oil level and possibly performing an engine oil change.

#### CLAIMS DATA:

| Labor Operation No: | Labor Description                                                         | Skill Category                    | Labor Time |
|---------------------|---------------------------------------------------------------------------|-----------------------------------|------------|
| 09-55-20-90         | Engine Oil Level, Inspect (0 - Introduction)                              | 1 - Engine Repair and Performance | 0.2 Hrs.   |
| 09-55-20-91         | Engine Oil Level Inspect and Perform Engine Oil Change (0 - Introduction) | 1 - Engine Repair and Performance | 0.3 Hrs.   |
| Failure Code        | ZY                                                                        | Service Action                    |            |

**SPARE PARTS:**

| Qty    | Part No.   | Description             | Notes |
|--------|------------|-------------------------|-------|
| 5 (AR) | 50022689AA | Engine Oil, 5W30, Quart |       |
| 1 (AR) | 04892339BE | Filter, Engine Oil      |       |

**DIAGNOSIS:**

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. **This RSU only applies to vehicles on the RSU VIN list.**

**REPAIR PROCEDURE:**

1. **Ensure the vehicle is on level ground and has either sat overnight or not been run for a minimum of two hours before proceeding.**
2. Open the hood.
3. Pull the engine oil dipstick from the dipstick tube.
4. Clean any engine oil from the engine oil dipstick [Fig. 1](#).



**Fig. 1**

Wipe Oil Dipstick Clean

5. Insert the engine oil dipstick into the engine oil dipstick tube and wait 30 seconds before proceeding to [Step 6](#).
6. Pull the engine oil dipstick from the engine oil dipstick tube and inspect the engine oil level indicated on the dipstick.

**NOTE:** It is easier to see the engine oil level on the dipstick while in the shade of the hood as opposed to in sunlight.

7. Is the engine oil level at an acceptable range [Fig. 2](#)?



**Fig. 2**  
Engine Oil Level - Acceptable Range

- YES>>> This bulletin has been completed. Use Inspection LOP (09-55-20-90) to close the active RSU.
  - NO>>> Proceed to [Step 8](#).
8. If the oil level is found to be in an unacceptable range [Fig. 3](#), inspect the engine oil level two more times to confirm the oil level. If the engine oil level is still at an unacceptable range, proceed to [Step 9](#).



**Fig. 3**  
Engine Oil Level - Unacceptable Range

9. Perform an engine oil and filter change. Refer to the detailed service procedures listed in DealerCONNECT>Service Library>Service Info>under: 09 - Engine, 2.0L / Lubrication / Standard Procedure.

#### **POLICY:**

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*