



SSM 55113 2024-2025 Ranger - All Power Outlets/Plugs Inoperative With DTC B1330:9A Stored In The BCM

Some 2024-2025 Ranger vehicles equipped with a cargo box power point plug may exhibit a condition where all interior/exterior power outlets/plugs are inoperative with diagnostic trouble code (DTC) B1330:9A stored in the body control module (BCM). This may be due to an inoperative light emitting diode (LED) in the cargo box power point plug. To correct the condition, replace the cargo box power point plug (service base part number 19A464). Refer to Workshop Manual (WSM), Section 414-05 > Removal and Installation > Alternating Current (AC) Power Outlet Socket > Cargo Box Power Point Plug. For claiming, use causal part 19A464 and labor operation MT19A464SSM up to 0.6 hours.