

Service

Chassis ID	Path
	25/Parts/Technical service bulletins/Service
Model	Identity
VN (4)	198258763
Publish date	ID/Operation
8/26/2026	V-257-001

Engine, crankcase ventilation, oil leakage

V-257-001

(August 2026)

Valid for


This TSB is valid for Volvo trucks.

Case description

Loose CCV mounting bolts and oil leak at CCV due to cracking of the housing. Mounting hardware found to be under-torqued after the vehicle was delivered.

Action

If the CCV is found to be leaking or cracked due to loose mounting hardware, replace the alternator cable bracket (24927871), which is mounted using the CCV housing bolts, with the new-design bracket (26096433). If CCV damage is found, the CCV must be renewed following IMPACT operation ID 2571-03-02-03 or 2571-03-03-01.

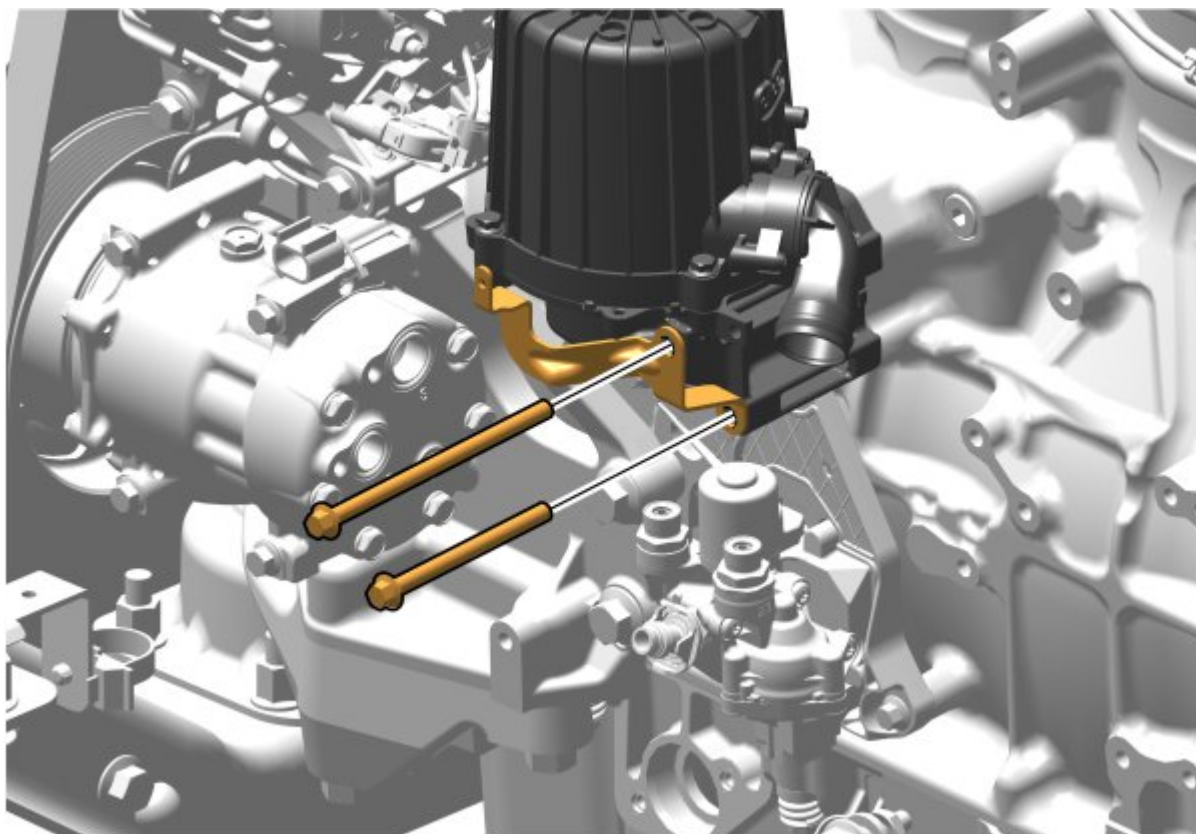

Issued by

Technical Service

Copyright to this documentation belongs to the Volvo Group. No reproduction, copying, change, amendment or other similar disposal is entitled without prior written consent by the Volvo Group

The information contained herein is current at the time of its original distribution, but is subject to change. The reader is advised that printed copies are uncontrolled.