



HYUNDAI

Technical Service Bulletin

GROUP BODY (INTERIOR AND EXTERIOR)	NUMBER 26-BD-008H
DATE AUGUST 2026	MODEL(S) SANTA FE (MX5A) SANTA FE HYBRID (MX5A HEV)


SUBJECT: WRINKLED OR TORN LEATHER SEATS – SEAT COVER REPLACEMENT

★ IMPORTANT


This field action requires both a reported condition consistent with the symptoms outlined in this TSB and dealer confirmation of those symptoms before any repair work is performed. If requirements are not met, any submitted claims are subject to debit. 5 / 60,000 New Vehicle Limited Warranty applies. See Warranty Information section for more details.

Description: Some Santa Fe (MX5A) and Santa Fe Hybrid (MX5A HEV) vehicles equipped with natural leather or Nappa leather seating surfaces may exhibit wrinkling on the first or second row seat cushions or seat backs, or tearing along the perforation holes due to the stiffness of the leather material. This bulletin provides instructions to replace the wrinkled or torn seat covers.

Seat cushions or seat backs damaged by external/outside influence are not covered.



Wrinkling



Tearing

Applicable Vehicles:

Model Year	Model	Production Dates
2024 – 2025	Santa Fe (MX5A)	04/04/2024 – 05/27/2025
	Santa Fe Hybrid (MX5A HEV)	03/06/2024 – 05/27/2025

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

Parts Information:

Model	Part Name	Part Number	Figure
Santa Fe (MX5A)	Covering Assy – FR Cush, LH	88160-R6110PZNQH 88160-R6110PZPQH 88160-R6110PZSQH 88160-R6210YZMQH 88160-R6210YZNQH 88160-R6210YZSQH	
	Covering Assy – FR Cush, RH	88260-R6110PZNQH 88260-R6110PZPQH 88260-R6110PZSQH 88260-R6210YZNQH 88260-R6210YZSQH 88260-R6230YZMQH 88260-R6230YZNQH 88260-R6230YZSQH	
	Covering Assy – FR Back, LH	88360-R6110PZNQH 88360-R6110PZPQH 88360-R6110PZSQH 88360-R6210YZMQH 88360-R6210YZNQH	
	Covering Assy – FR Back, RH	88460-R6110PZNQH 88460-R6110PZPQH 88460-R6110PZSQH 88460-R6210YZNQH 88460-R6210YZSQH 88460-R6230YZMQH 88460-R6230YZNQH 88460-R6230YZSQH	
	Covering Assy – RR Seat Cushion, LH	89160-R6310YZMQH 89160-R6310YZNQH 89160-R6310YZSQH 89160-R6311YZMQH 89160-R6311YZNQH 89160-R6311YZSQH 89160-R6520PZNQH 89160-R6520PZPQH 89160-R6520PZSQH 89160-R6521PZNQH 89160-R6521PZPQH 89160-R6521PZSQH	

SUBJECT:**WRINKLED OR TORN LEATHER SEATS – SEAT COVER REPLACEMENT**

Model	Part Name	Part Number	Figure
Santa Fe (MX5A)	Covering Assy – RR Seat Cushion, RH	89260-R6310YZMQH 89260-R6310YZNQH 89260-R6310YZSQH 89260-R6311YZMQH 89260-R6311YZNQH 89260-R6311YZSQH 89260-R6520PZNQH 89260-R6520PZPQH 89260-R6520PZSQH 89260-R6521PZNQH 89260-R6521PZPQH 89260-R6521PZSQH	
	Covering Assy – RR Seat Back, LH	89360-R6310YZMQH 89360-R6310YZNQH 89360-R6310YZSQH 89360-R6530PZNQH 89360-R6530PZPQH 89360-R6530PZSQH	
Santa Fe Hybrid (MX5A HEV)	Covering Assy – RR Seat Back, RH	89460-R6310YZMQH 89460-R6310YZNQH 89460-R6310YZSQH 89460-R6530PZNQH 89460-R6530PZPQH 89460-R6530PZSQH	

Warranty Information:

Model	Op. Code	Operation	Op. Time	Causal Part	Nature Code	Cause Code
Santa Fe (MX5A)	50DA36R0	FR Seat Cushion Assembly Replacement (LH or RH)	0.8 M/H	88160-R6110PZN	A32	ZZ4
	50DA36R1	FR Seat Cushion Assembly Replacement (Both LH & RH)	1.2 M/H			
	50DA36R2	FR Seat Back Assembly Replacement (LH or RH)	0.8 M/H	88360-R6110PZN		
	50DA36R3	FR Seat Back Assembly Replacement (Both LH & RH)	1.3 M/H			
Santa Fe Hybrid (MX5A HEV)	50DA36R4	RR Seat Cushion Assembly Replacement (LH or RH)	0.6 M/H	89160-R6521PZN		
	50DA36R5	RR Seat Cushion Assembly Replacement (Both LH & RH)	0.9 M/H			
	50DA36R6	RR Seat Back Assembly Replacement (LH or RH)	0.8 M/H	89360-R6310YZM		
	50DA36R7	RR Seat Back Assembly Replacement (Both LH & RH)	1.3 M/H			

NOTE 1: Submit a campaign claim on the "Claim Entry/Edit/Submit" screen on WebDCS and attach all required Digital Documentation per TSB to the claim.

NOTE 2: 5 / 60,000 New Vehicle Limited Warranty (NVLW) applies to the part(s) and repair procedure(s) outlined in this TSB. Prior to beginning any repair work, ensure the part(s) associated with the repair procedure are within NVLW, observing mileage and Warranty Start Date or date of first use. If the subject part(s) are out of warranty coverage, the retailer has the option to submit a Prior Approval (PA) Request for goodwill consideration on a case-by-case basis.

NOTE 3: If any part(s) not subject to this TSB are found in need of replacement while performing the repair procedure, and the affected part(s) are still under warranty, the retailer may submit a separate claim using the same repair order. If the part(s) not subject to this TSB are out of warranty coverage, the retailer has the option to submit a PA Request for goodwill consideration on a case-by-case basis.

NOTE 4: This TSB includes repair justification photos. Op times include VIN, mileage, and repair justification photo(s) as outlined in the Digital Documentation Policy. Each seat cover replacement requires an uploaded photo.

NOTE 5: The incident part(s) are subject to callback through the normal Warranty Technical Center (WTC) parts return process. **Claim is subject to debit if the part is not returned.**

Service Procedure:

DIGITAL DOCUMENTATION



This TSB includes repair justification photos. Refer to the latest Warranty Digital Documentation Policy for requirements.

NOTICE

Seat cushions or seat backs damaged by external/outside influence are **NOT** covered.

Applying the recommended torque to all fasteners is essential to reduce potential issues from occurring after the service procedure.

1.

DIGITAL DOCUMENTATION



Using the STUI camera function, take a photo(s) of each affected seat cover focusing on the defect identified. Each seat cover replacement requires an uploaded photo.

Upload the photo(s) to STUI.

NOTE: If the STUI camera function is **NOT** used, write the last 6 digits of the VIN and date of repair on a piece of paper to include in the photo.



2. Remove and replace the affected seat cover(s) by referring to the shop manual:
 - **Body (Interior / Exterior / Electrical) > Front Seat > Front Seat Cushion Cover > Removal and Installation**
 - **Body (Interior / Exterior / Electrical) > Front Seat > Front Seat Back Cover > Removal and Installation**
 - **Body (Interior / Exterior / Electrical) > Rear Seat > Rear Seat Cushion Cover > Removal and Installation**
 - **Body (Interior / Exterior / Electrical) > Rear Seat > Rear Seat Back Cover > Removal and Installation**
3. Reinstall all parts in the reverse order of the removal process.
4. Confirm the proper operation of the seat(s).
5. The service procedure is now complete.